

---

---

## Paints and varnishes — Determination of film thickness

*Peintures et vernis — Détermination de l'épaisseur du feuil*



**COPYRIGHT PROTECTED DOCUMENT**

© ISO 2019

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
CP 401 • Ch. de Blandonnet 8  
CH-1214 Vernier, Geneva  
Phone: +41 22 749 01 11  
Fax: +41 22 749 09 47  
Email: [copyright@iso.org](mailto:copyright@iso.org)  
Website: [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

Page

<b>Foreword</b>	<b>v</b>
<b>Introduction</b>	<b>vi</b>
<b>1 Scope</b>	<b>1</b>
<b>2 Normative references</b>	<b>1</b>
<b>3 Terms and definitions</b>	<b>1</b>
<b>4 Determination of wet-film thickness</b>	<b>5</b>
4.1 General	5
4.2 Mechanical methods	5
4.2.1 Principle	5
4.2.2 Field of application	5
4.2.3 General	5
4.2.4 Method 1A — Comb gauge	5
4.2.5 Method 1B — Wheel gauge	6
4.2.6 Method 1C — Dial gauge	7
4.3 Gravimetric method	9
4.3.1 Principle	9
4.3.2 Field of application	9
4.3.3 General	9
4.3.4 Method 2 — By difference in mass	9
4.4 Photothermal method	10
4.4.1 Principle	10
4.4.2 Field of application	10
4.4.3 General	10
4.4.4 Method 3 — Determination using thermal properties	11
<b>5 Determination of dry-film thickness</b>	<b>11</b>
5.1 General	11
5.2 Mechanical methods	11
5.2.1 Principle	11
5.2.2 Field of application	12
5.2.3 General	12
5.2.4 Method 4A — By difference in thickness	12
5.2.5 Method 4B — Depth gauging	15
5.2.6 Method 4C — Surface profile scanning	17
5.3 Gravimetric method	18
5.3.1 Principle	18
5.3.2 Field of application	19
5.3.3 General	19
5.3.4 Method 5 — By difference in mass	19
5.4 Optical methods	19
5.4.1 Principle	19
5.4.2 Field of application	22
5.4.3 General	22
5.4.4 Method 6A — Cross-sectioning	23
5.4.5 Method 6B — Wedge cut	24
5.4.6 Method 6C — White-light interferometry	24
5.5 Magnetic methods	25
5.5.1 Principle	25
5.5.2 Field of application	25
5.5.3 General	25
5.5.4 Method 7A — Magnetic pull-off gauge	25
5.5.5 Method 7B.1 — Magnetic-flux gauge	26
5.5.6 Method 7B.2 — Magnetic field change, magnetic-induction principle	27

5.5.7	Method 7C — Eddy-current gauge .....	28
5.6	Radiological method .....	29
5.6.1	Principle .....	29
5.6.2	Field of application .....	29
5.6.3	General .....	29
5.6.4	Method 8 — Beta backscatter method .....	30
5.7	Photothermal method .....	30
5.7.1	Principle .....	30
5.7.2	Field of application .....	31
5.7.3	General .....	31
5.7.4	Method 9 — Determination using thermal properties .....	31
5.8	Acoustic method .....	32
5.8.1	Principle .....	32
5.8.2	Field of application .....	32
5.8.3	General .....	32
5.8.4	Method 10 — Ultrasonic reflection .....	32
5.9	Electromagnetic method .....	33
5.9.1	Method 11 — Terahertz method .....	33
<b>6</b>	<b>Determination of thickness of uncured powder layers .....</b>	<b>35</b>
6.1	General .....	35
6.2	Gravimetric method .....	35
6.2.1	Principle .....	35
6.2.2	Field of application .....	35
6.2.3	General .....	35
6.2.4	Method 12 — By difference in mass .....	35
6.3	Magnetic methods .....	36
6.3.1	Principle .....	36
6.3.2	Field of application .....	36
6.3.3	General .....	36
6.3.4	Method 13A — Magnetic-induction method .....	36
6.3.5	Method 13B — Eddy-current .....	37
6.4	Photothermal method .....	38
6.4.1	Principle .....	38
6.4.2	Field of application .....	39
6.4.3	General .....	39
6.4.4	Method 14 — Determination using thermal properties .....	39
<b>7</b>	<b>Test report .....</b>	<b>39</b>
	<b>Annex A (informative) Overview of methods .....</b>	<b>41</b>
	<b>Annex B (informative) Measurement of film thickness on rough surfaces .....</b>	<b>44</b>
	<b>Annex C (informative) Factors affecting the precision of readings obtained when measuring on wooden substrates .....</b>	<b>46</b>
	<b>Bibliography .....</b>	<b>48</b>

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see [www.iso.org/directives](http://www.iso.org/directives)).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see [www.iso.org/patents](http://www.iso.org/patents)).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT) see [www.iso.org/iso/foreword.html](http://www.iso.org/iso/foreword.html).

This document was prepared by Technical Committee ISO/TC 35, *Paints and varnishes*, SC 9, *General test methods for paints and varnishes*.

This fifth edition cancels and replaces the fourth edition (ISO 2808:2007), which has been technically revised. The main changes compared to the previous edition are as follows:

- the terms and definitions have been updated to ISO 4618 and ISO/IEC Guide 99;
- the principle has been revised;
- white-light interferometer has been added as method 6C;
- the terahertz method has been added as method 11;
- the existing methods have been adapted to the current state of metrology;
- the characterisation of the methods and procedures in [Annex A](#) have been revised;
- information in [Annex A](#) on the precision of the individual methods has been adapted to current standards;
- the references to test standards and constructions standards in [Annex A](#) have been updated;
- former Clause 7 on measurement of the film thickness on rough surfaces has been moved to [Annex B](#);
- [Annex C](#), on factors which influence measuring accuracy when measurements are performed on wood has been added.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at [www.iso.org/members.html](http://www.iso.org/members.html).

## Introduction

This document consistently enumerates the individual coatings applied in a multi-layer system by referring to the first coating applied on the substrate as coating 1. Some other standards referring to individual test methods enumerate in reverse order.

# Paints and varnishes — Determination of film thickness

## 1 Scope

This document describes methods for measuring the thickness of coatings applied to a substrate. Methods for determining wet-film thickness, dry-film thickness and the film thickness of uncured powder layers are described.

For each method described, this document provides an overview of the field of application, existing standards and the precision.

Information on measuring film thickness on rough surfaces is given in [Annex B](#).

Information on measuring film thickness on wooden substrates is given in [Annex C](#).

## 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 3611, *Geometrical product specifications (GPS) — Dimensional measuring equipment: Micrometers for external measurements — Design and metrological characteristics*

ISO 4618, *Paints and varnishes — Terms and definitions*

ISO 8503-1, *Preparation of steel substrates before application of paints and related products — Surface roughness characteristics of blast-cleaned steel substrates — Part 1: Specifications and definitions for ISO surface profile comparators for the assessment of abrasive blast-cleaned surfaces*

## 3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 4618 and the following apply.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <http://www.electropedia.org/>

### 3.1

#### **film thickness**

distance between the surface of the film and the surface of the substrate

### 3.2

#### **wet-film thickness**

thickness of a freshly applied wet coating material, measured immediately after application

### 3.3

#### **dry-film thickness**

thickness of a coating remaining on the surface when the coating has hardened

### 3.4

#### **thickness of uncured powder layer**

thickness of a freshly applied coating material in powder form, measured immediately after application and before stoving

### 3.5

#### **relevant surface area**

part of an object covered or to be covered by the coating and for which the coating is essential for serviceability and/or appearance

Note 1 to entry: Measurement of this property is only required for the extended evaluation of film thickness measurements; see [Clause 7](#), k) and l).

### 3.6

#### **test area**

representative part of the relevant surface area within which an agreed number of single measurements is made as a spot-check

Note 1 to entry: Measurement of this property is only required for the extended evaluation of film thickness measurements; see [Clause 7](#), k) and l).

### 3.7

#### **measurement area**

area over which a single measurement is made

Note 1 to entry: Measurement of this property is only required for the extended evaluation of film thickness measurements; see [Clause 7](#), k) and l).

### 3.8

#### **minimum local film thickness**

lowest value of the local film thickness found on the relevant surface area of a particular test specimen

Note 1 to entry: Measurement of this property is only required for the extended evaluation of film thickness measurements; see [Clause 7](#), k) and l).

### 3.9

#### **maximum local film thickness**

highest value of the local film thickness found on the relevant surface area of a particular test specimen

Note 1 to entry: Measurement of this property is only required for the extended evaluation of film thickness measurements; see [Clause 7](#), k) and l).

### 3.10

#### **mean film thickness**

arithmetic mean of all the individual *dry-film thicknesses* ([3.3](#)) in the test area or the result of a gravimetric determination of the thickness

Note 1 to entry: Measurement of this property is only required for the extended evaluation of film thickness measurements; see [Clause 7](#), k) and l).

### 3.11

#### **calibration**

operation that, under specified conditions, in a first step, establishes a relation between the quantity values with measurement uncertainties provided by measurement standards and corresponding indications with associated measurement uncertainties and, in a second step, uses this information to establish a relation for obtaining a measurement result from an indication

Note 1 to entry: A calibration may be expressed by a statement, calibration function, calibration diagram, calibration curve, or calibration table. In some cases, it may consist of an additive or multiplicative correction of the indication with associated measurement uncertainty.

Note 2 to entry: Calibration should not be confused with adjustment of a measuring system, often mistakenly called "self-calibration", nor with verification of calibration.

Note 3 to entry: Often, the first step alone in the above definition is perceived as being calibration.

[SOURCE: ISO/IEC Guide 99:2007, 2.39]



**3.12****verification**

provision of objective evidence that a given item fulfils specified requirements

EXAMPLE 1 Confirmation that a given reference material as claimed is homogeneous for the quantity value and measurement procedure concerned, down to a measurement portion having a mass of 10 mg.

EXAMPLE 2 Confirmation that performance properties or legal requirements of a measuring system are achieved.

EXAMPLE 3 Confirmation that a target measurement uncertainty can be met.

Note 1 to entry: When applicable, measurement uncertainty should be taken into consideration.

Note 2 to entry: The item may be, e.g. a process, measurement procedure, material, compound, or measuring system.

Note 3 to entry: The specified requirements may be, e.g. that a manufacturer's specifications are met.

Note 4 to entry: Verification in legal metrology, as defined in VIML, and in conformity assessment in general, pertains to the examination and marking and/or issuing of a verification certificate for a measuring system.

Note 5 to entry: Verification should not be confused with calibration. Not every verification is a validation.

Note 6 to entry: In chemistry, verification of the identity of the entity involved, or of activity, requires a description of the structure or properties of that entity or activity.

[SOURCE: ISO/IEC Guide 99:2007, 2.44]

**3.13****reference material**

RM

material, sufficiently homogeneous and stable with reference to specified properties, which has been established to be fit for its intended use in measurement or in examination of nominal properties

Note 1 to entry: Examination of a nominal property provides a nominal property value and associated uncertainty. This uncertainty is not a measurement uncertainty.

Note 2 to entry: Reference materials with or without assigned quantity values can be used for measurement precision control whereas only reference materials with assigned quantity values can be used for calibration or measurement trueness control.

Note 3 to entry: "Reference material" comprises materials embodying quantities as well as nominal properties.

EXAMPLE 1 Examples of reference materials embodying quantities:

- a) water of stated purity, the dynamic viscosity of which is used to calibrate viscometers;
- b) human serum without an assigned quantity value for the amount-of-substance concentration of the inherent cholesterol, used only as a measurement precision control material;
- c) fish tissue containing a stated mass fraction of a dioxin, used as a calibrator.

EXAMPLE 2 Examples of reference materials embodying nominal properties:

- a) colour chart indicating one or more specified colours;
- b) DNA compound containing a specified nucleotide sequence;
- c) urine containing 19-androstenedione.

Note 4 to entry: A reference material is sometimes incorporated into a specially fabricated device.

EXAMPLE 3 Substance of known triple-point in a triple-point cell.

EXAMPLE 4 Glass of known optical density in a transmission filter holder.

EXAMPLE 5 Spheres of uniform size mounted on a microscope slide.

Note 5 to entry: Some reference materials have assigned quantity values that are metrologically traceable to a measurement unit outside a system of units. Such materials include vaccines to which International Units (IU) have been assigned by the World Health Organization.

Note 6 to entry: In a given measurement, a given reference material can only be used for either calibration or quality assurance.

Note 7 to entry: The specifications of a reference material should include its material traceability, indicating its origin and processing (Accred. Qual. Assur.:2006).

Note 8 to entry: ISO/REMCO has an analogous definition but uses the term "measurement process" to mean "examination" (ISO 15189:2007, 3.4), which covers both measurement of a quantity and examination of a nominal property.

Note 9 to entry: Reference materials may be coated thickness standards, or shims. If agreed to by the contracting parties, a part of the test specimen may be used as a thickness standard for a particular job.

[SOURCE: ISO/IEC Guide 99:2007, 5.13, modified — Note 9 to entry has been added.]

### 3.14

#### **adjustment**

#### **adjustment of a measuring system**

set of operations carried out on a measuring system so that it provides prescribed indications corresponding to given values of a quantity to be measured

Note 1 to entry: Types of adjustment of a measuring system include zero adjustment of a measuring system, offset adjustment, and span adjustment (sometimes called gain adjustment).

Note 2 to entry: Adjustment of a measuring system should not be confused with calibration, which is a prerequisite for adjustment.

Note 3 to entry: After an adjustment of a measuring system, the measuring system must usually be recalibrated.

Note 4 to entry: Most digital measurement instruments can be adjusted on a thickness standard or on a shim, where the thickness of the coating or of the shim is known.

[SOURCE: ISO/IEC Guide 99:2007, 3.11, modified — Note 4 to entry has been added and "adjustment" is used as the first preferred term.]

### 3.15

#### **accuracy**

measurement accuracy

accuracy of measurement

closeness of agreement between a measured quantity value and a true quantity value of a measurand

Note 1 to entry: The concept "measurement accuracy" is not a quantity and is not given a numerical quantity value. A measurement is said to be more accurate when it offers a smaller measurement error.

Note 2 to entry: The term "measurement accuracy" should not be used for measurement trueness and the term measurement precision should not be used for 'measurement accuracy', which, however, is related to both these concepts.

Note 3 to entry: "Measurement accuracy" is sometimes understood as closeness of agreement between measured quantity values that are being attributed to the measurand.

[SOURCE: ISO/IEC Guide 99:2007, 2.13, modified — "accuracy" is used as the preferred term.]

## 4 Determination of wet-film thickness

### 4.1 General

[Annex A](#) gives an overview of the methods used for the determination of wet-film thickness.

### 4.2 Mechanical methods

#### 4.2.1 Principle

With mechanical procedures, the measuring instrument (see [Figures 1, 2 and 3](#), Key 4) passes through by the coating being placed on the surface of the substrate. The difference between the points of contact (substrate, see [Figures 1, 2 and 3](#), Key 1) and the coating surface touched from the top of the measurement instrument ([Figures 1, 2 and 3](#), Key 3) corresponds to the readable wet-film thickness.

#### 4.2.2 Field of application

The mechanical principle is suitable for all film-substrate combinations. The substrate has to be flat in at least one direction in the area where the measurement is performed. Curvature of the surface in a single plane is permissible (e.g. internal or external surface of pipes).

#### 4.2.3 General

Classification as a destructive or non-destructive method depends on:

- a) the rheological properties of the coating material;
- b) the nature of the wetting contact between the contact surfaces of the measurement instrument and the coating material;
- c) whether the thickness measurements will make the coating unsuitable for the purpose for which it is intended.

Since the possibility of pigment particles remaining between the gauge and the substrate cannot be excluded, all mechanical methods contain a systematic error: the film thickness displayed is smaller than the actual wet-film thickness by at least the mean diameter of the pigment particles.

In the case of a wheel gauge (method 1B, see [4.2.5](#)), the wheel has to be wetted by the coating material. If not, this represents a further source of systematic error which can result in exaggerated readings and is a function of:


- the surface tension and the rheological properties of the coating material;
- the material of the wheel gauge;
- the speed at which the wheel is turned.

#### 4.2.4 Method 1A — Comb gauge

##### 4.2.4.1 Description of instrument

A comb gauge is a flat plate made of a corrosion-resistant material with teeth along its edges (see [Figure 1](#)). The reference teeth at the corners of the plate define a baseline along which the inner teeth are arranged to give a graduated series of gaps. Each tooth is labelled with the assigned gap value.

With commercially available comb gauges, the maximum thickness which can be measured is typically 2 000 µm and the smallest increment is typically 5 µm.

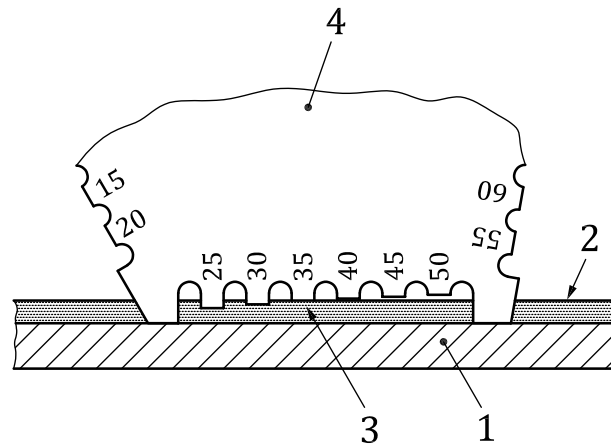**Key**

- 1 substrate
- 2 coating
- 3 point of wetting contact
- 4 comb gauge

**Figure 1 — Example of a comb gauge**

#### 4.2.4.2 Procedure

Ensure that the teeth are clean and not worn out or damaged. Place the comb gauge onto the flat specimen surface such that the teeth are normal to the plane of the surface. Allow sufficient time for the coating to wet the teeth prior to removing the gauge.

In the case of specimens curved in a single plane, the comb gauge shall be placed in position parallel to the axis of curvature.

The thickness shall be measured directly after application since the result will be influenced, for example, by physical drying, curing or solvent loss.

Take the greatest gap reading of the tooth wetted by the coating material as the wet-film thickness.

#### 4.2.5 Method 1B — Wheel gauge

##### 4.2.5.1 Description of instrument

A wheel gauge consists of a wheel, made of hardened and corrosion-resistant steel, with three projecting rims (see [Figure 2](#)).


Two rims are ground to the same diameter and are configured concentrically to the wheel axle. The third rim has a smaller diameter and is eccentrically ground. One of the outer rims has a scale from which the respective protrusion of the concentric rims relative to the eccentric rim can be read.

Two versions are available:

- version 1 has the eccentric rim located between the concentric rims;
- version 2 has the eccentric rim located systematically outside the concentric rims and closely adjacent to one of them.

**NOTE** Unlike version 1, the design of version 2 allows parallax-free reading of the wet-film thickness.

With commercially available wheel gauges, the maximum thickness which can be measured is typically 1 500  $\mu\text{m}$  and the smallest increment is typically 2  $\mu\text{m}$ .

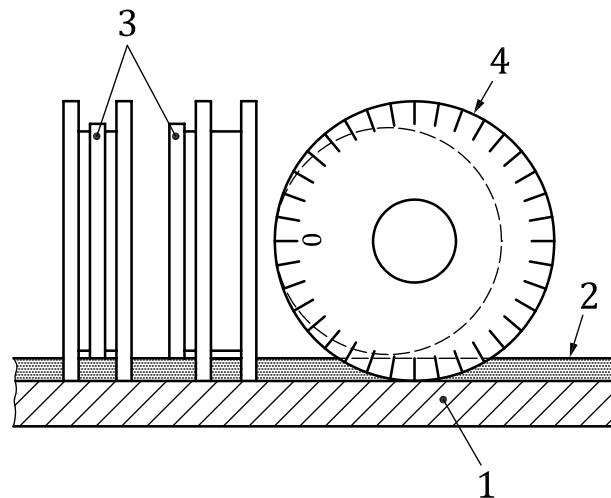

#### Key

- 1 substrate
- 2 coating
- 3 eccentric rim
- 4 wheel gauge

**Figure 2 — Example of a wheel gauge**

#### 4.2.5.2 Procedure

Grip the wheel gauge with the thumb and index finger by the wheel axle and press the concentric rims onto the surface at the point of the largest reading on the scale.

In the case of specimens curved in a single plane, the axis of curvature and the wheel gauge axle shall be parallel.

Roll the wheel gauge in one direction, lift it from the surface and read off the highest scale reading at which the eccentric rim is still wetted by the coating material. Clean the gauge and repeat in the other direction.

Calculate the wet-film thickness as the arithmetic mean of these readings.

The thickness shall be measured directly after application since the result will be influenced, for example, by physical drying, curing or solvent loss.

To minimize the effect of surface tension on the result, observe how the paint wets the eccentric rim and record the scale reading at the first point of contact. This is only possible with version 2 of the wheel gauge.


#### 4.2.6 Method 1C — Dial gauge

##### 4.2.6.1 Instrument and reference materials (reference standard)


##### 4.2.6.1.1 Dial gauge [see [Figure 3 a\)](#) and [b\)](#)]

Analogue dial gauges conforming to the requirements of ISO 463 and digital dial gauges are typically capable of measuring to an accuracy of 5  $\mu\text{m}$  (analogue dial gauge) or 1  $\mu\text{m}$  (digital dial gauge), or better. The gauge can have an analogue or digital display.

The underside of the dial gauge has two contact pins of equal length located equidistant from the movable plunger and in a straight line with it. An adjusting screw is used to make careful adjustments to the position of the plunger in its guideway.

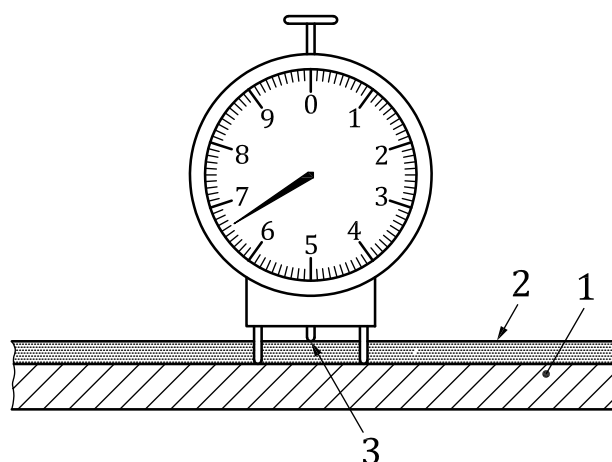

a) Example of an analogue dial gauge

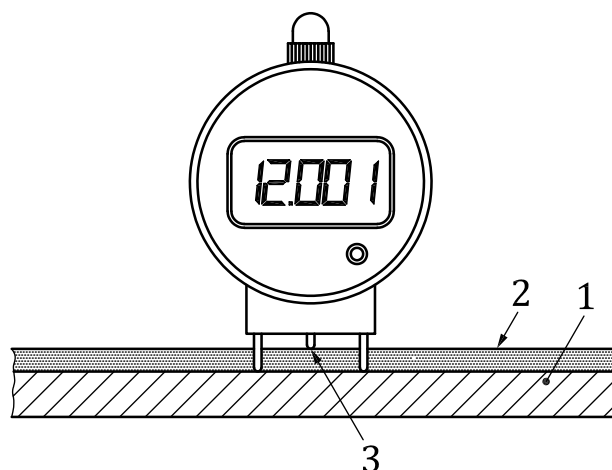

b) Example of a digital dial gauge

**Key**

- 1 substrate
- 2 coating
- 3 plunger

**Figure 3 — Examples of an analogue and a digital dial gauge**

**4.2.6.1.2 Reference material for zeroing the gauge**

A flat reference plate is required for zeroing the gauge. The reference plate shall be a polished glass plate.

**4.2.6.2 Procedure**

Zero the dial gauge on the reference plate with the measuring tip adjusted so that it is just touching the plate.

Screw the plunger back from the zeroing position.

Place the contact pins of the dial gauge on the specimen so that they are perpendicular to the surface of the substrate and carefully lower the plunger down until the measuring tip is just touching the coating material.

In the case of specimens curved in a single plane, the plungers shall be placed in position parallel to the axis of curvature.

The thickness shall be measured directly after application since the result will be influenced, for example, by physical drying, curing or solvent loss.

Read the wet-film thickness directly from the gauge.

### 4.3 Gravimetric method

#### 4.3.1 Principle

A coating is applied and the thickness is determined by dividing the mass of the coating by its density and by the coated surface area.

The wet-film thickness,  $t_w$ , in micrometres, is calculated with [Formula \(1\)](#)

$$t_w = \frac{m - m_0}{A \cdot \rho} \quad (1)$$

where

$m_0$  is the mass of the uncoated specimen, in grams;

$m$  is the mass of the coated specimen, in grams;

$A$  is the coated surface area, in square metres;

$\rho$  is the density of the liquid coating material applied, in grams per cubic centimetres.

NOTE The density of the liquid coating material applied can be determined in accordance with ISO 2811-1, ISO 2811-2, ISO 2811-3 or ISO 2811-4.

#### 4.3.2 Field of application

The gravimetric principle is generally applicable, provided that the amount of highly volatile substances in the liquid coating material is low.

#### 4.3.3 General

Determination using the gravimetric principle yields the mean wet-film thickness over the entire coated surface area. With spray application in particular, the reverse side of the specimen shall be masked to prevent measurement errors resulting from partial coating of the reverse (overspray). Any masking of the reverse side shall be removed before weighing the coated specimen.

#### 4.3.4 Method 2 — By difference in mass

##### 4.3.4.1 Apparatus

Required are scales capable of weighing up to 500 g to the nearest 1 mg.

##### 4.3.4.2 Procedure

Weigh the specimen first uncoated and then coated and calculate the wet-film thickness using [Formula \(1\)](#).


## 4.4 Photothermal method

### 4.4.1 Principle

The film thickness is determined from the difference between the time a thermal wave is radiated towards the coating and the time the re-emitted wave (either heat or ultrasonic) is detected (see [Figure 4](#)).

Irrespective of the type of excitation involved or the method of detection, all photothermal methods use the same principle: the periodic or pulsed introduction of energy in the form of heat into a specimen and the subsequent detection of the local temperature increase.

The time difference measured is compared against values obtained with the instrument for films of known thickness under fixed conditions (excitation energy, pulse length, excitation frequency, etc.) (see [4.4.4.2](#)).

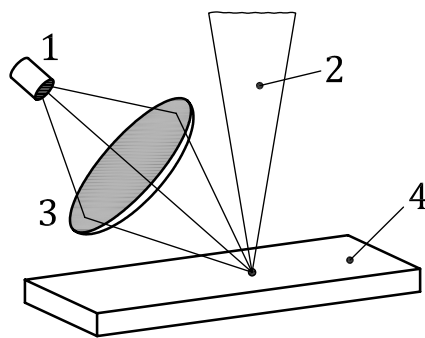

#### Key

- 1 infrared detector
- 2 excitation beam
- 3 thermal radiation
- 4 specimen

**Figure 4 — Representation of radiometric detection**

### 4.4.2 Field of application

The photothermal principle is basically suitable for all film-substrate combinations. It can also be used to determine the thicknesses of the individual layers in a multilayer coating, provided the layers are sufficiently distinct from each other with respect to their thermal conductivity and reflection properties.

The required minimum substrate thickness is a function of the measurement system used (see [4.4.4.1.1](#)) and the film-substrate combination.

### 4.4.3 General

Classification of the method as destructive or non-destructive depends on the purpose of the coating. The thermal energy absorbed by the coating could have an impact on the coating owing to the local heating effect produced.



#### 4.4.4 Method 3 — Determination using thermal properties

##### 4.4.4.1 Instrument and reference materials (reference specimens)

###### 4.4.4.1.1 Measurement system

There are various methods for producing thermal waves in a coating material and for detecting the thermal effects induced at the heated location in the specimen (see EN 15042-2<sup>[28]</sup>). Thermal radiation sources (e.g. laser sources, light-emitting diodes, incandescent light sources) are mainly used as the excitation system for coatings.

The following detection methods are used:

- detection of the re-emitted thermal radiation (photothermal radiometry);
- detection of the change in refractive index (in the heated air above the measurement area);
- pyroelectric detection (heat flow measurement).

###### 4.4.4.1.2 Reference material

Reference materials with different absorption properties and a range of film thicknesses are required for calibration purposes (see, for example, EN 15042-2<sup>[28]</sup>).

##### 4.4.4.2 Calibration

Calibrate the measurement system with the reference materials (see [4.4.4.1.2](#)) for each film-substrate combination (in particular for each coating material).

##### 4.4.4.3 Procedure

Operate the apparatus and measure the film thickness in accordance with the manufacturer's instructions.

## 5 Determination of dry-film thickness

### 5.1 General

[Annex A](#) gives an overview of the methods used for determination of dry-film thickness.

### 5.2 Mechanical methods

#### 5.2.1 Principle

A micrometre or dial gauge (method 4A, see [5.2.4](#)) is used to measure the film thickness as the difference between the total thickness (substrate + film) and the substrate thickness.

There are two ways of determining the film thickness:

- a) Measurements are made before and after coating removal (destructive).

The total thickness is first measured in a defined measurement area and then, after the coating has been removed in the measurement area, the substrate thickness is measured.

- b) Measurements are made before and after coating application (non-destructive).

The substrate thickness is first measured and then the total thickness is measured in the same measurement area after coating.

The film thickness is calculated from the difference between the two readings.

A depth gauge (method 4B, see 5.2.5) or a profilometer (method 4C, see 5.2.6) enables the film thickness to be determined directly as the difference in height between the surface of the film and the surface of the exposed substrate.

NOTE Only the “coating removal” variant is possible with a depth gauge or profilometer (methods 4B and 4C).

## 5.2.2 Field of application

The mechanical principle is basically suitable for all film-substrate combinations. Where mechanical gauging is used, the substrate and coating shall be constituted so as to prevent the reading from being falsified as a result of the measuring tip creating an indentation.

The micrometre or dial gauge (method 4A) is also suitable for measuring the film thickness of cylindrical specimens of circular cross-section (e.g. wires, pipes).

The profilometer (method 4C) is recognized as the referee method in the event of a dispute.

## 5.2.3 General

In the “coating application” variant, a template with labelled holes is used to ensure that the determination of the substrate thickness and total thickness is carried out at exactly the same points.

NOTE 1 The “coating application” variant is preferred in the case of plastic substrates since in most cases the substrate cannot be exposed without causing damage.

In the “coating removal” variant, the measurement areas shall be circled and labelled. The coating shall be carefully and completely removed in the measurement areas without damaging the substrate mechanically or chemically. The substrate may be partly masked using adhesive tape before coating in order to obtain well-defined steps from one layer to the next.

In the case of the depth gauge and profilometer (methods 4B and 4C), the coating which is not removed in the region of the measurement area shall remain undamaged.

In the case of the profilometer (method 4C), the shoulder between the substrate and the film surface shall be sufficiently well defined.

With hard substrates (e.g. glass) the coating can be removed mechanically, but with less hard substrates (e.g. steel) the coating shall be removed chemically using a solvent or paint remover.

NOTE 2 In the case of less hard substrate materials such as steel, the film can be cut through with a core drill of 10 mm diameter and the disc of coating thus formed removed with a solvent or paint remover.

All surfaces (coating, substrate, reverse side of specimen) which are contacted or gauged shall be clean and free from film residues.

## 5.2.4 Method 4A — By difference in thickness

### 5.2.4.1 Description of instrument

#### 5.2.4.1.1 Micrometre

##### 5.2.4.1.1.1 General

The micrometre shall be capable of measuring to the nearest 5 µm. It shall be fitted with a ratchet to limit the force exerted by the spindle on the test surface.

#### 5.2.4.1.1.2 Version 1 — Fixed to a stand

A micrometre head with a plane measuring face is clamped to a stand with a flat measuring table surface such that its height can be adjusted. The measuring face shall be aligned parallel to the measuring table surface.

#### 5.2.4.1.1.3 Version 2 — Hand-held (see [Figure 5](#))

The usual term for this kind of instrument is an outside micrometre, although it is also known as micrometre callipers for external use. The micrometre shall conform to the requirements of ISO 3611. The measuring faces of the spindle and the anvil shall be plane and parallel to each other.

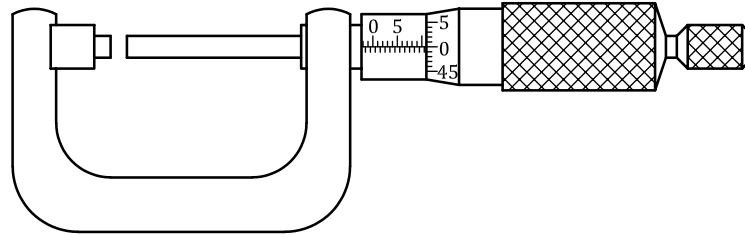


Figure 5 — Outside micrometre

#### 5.2.4.1.2 Dial gauge

##### 5.2.4.1.2.1 General

Analogue dial gauges conforming to the requirements of ISO 463 and digital dial gauges are typically capable of measuring to an accuracy of 5  $\mu\text{m}$  (analogue dial gauge) or 1  $\mu\text{m}$  (digital dial gauge), or better. The gauge shall be fitted with a device for lifting the measuring tip. The shape of the measuring tip shall be selected as a function of the hardness of the coating material whose thickness is to be measured (spherical for hard materials, plane for soft materials).

##### 5.2.4.1.2.2 Version 1 — Fixed to a stand

The dial gauge is clamped to a stand as shown in [Figure 6](#). If a plane stylus tip is used, the measurement surface shall be aligned parallel to the measuring table surface.


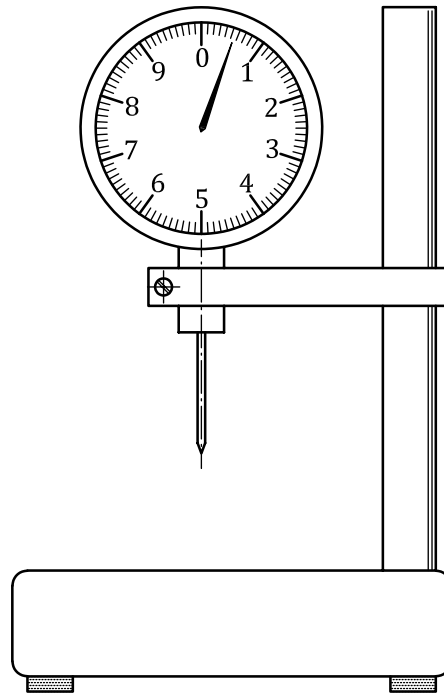


Figure 6 — Dial gauge fixed to a stand

#### 5.2.4.1.2.3 Version 2 — Hand-held

This dial gauge is fitted with a hand grip. The device for lifting the plunger shall be configured such that the gauge can be operated with one hand. The interchangeable tip of the anvil shall be located opposite the movable measuring tip. The shape of the measuring tip shall be selected as a function of the hardness of the material to be tested (spherical for hard materials, plane for soft materials).

If both the measuring tip and the anvil are of plane design (such as in the foil thickness gauge shown in [Figure 7](#)), the measurement surfaces shall be parallel to each other.

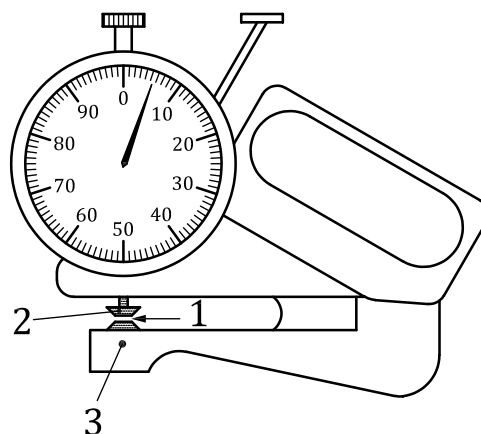

#### Key

- 1 gauge aperture
- 2 upper measuring tip
- 3 measuring plug

Figure 7 — Foil thickness gauge

### 5.2.4.2 Procedure

Prepare the specimen as specified in [5.2.3](#) for the “coating removal” and “coating application” variants (see [5.2.1](#)).

Operate all instruments so that the coated side of the specimen or the side to be coated is facing the spindle (micrometre, see [5.2.4.1.1](#)) or the contact element (dial gauge, see [5.2.4.1.2](#)) in the “coating removal” and “coating application” variants, respectively.

When using an instrument clamped to a stand ([5.2.4.1.1](#) and [5.2.4.1.2](#), version 1 in each case), place the specimen on the measuring table surface.

When using a hand-held type ([5.2.4.1.1](#) and [5.2.4.1.2](#), version 2 in each case) hold the specimen against the fixed measuring tip.

NOTE The grip of the instruments specified in [5.2.4.1.1](#) and [5.2.4.1.2](#), version 2 in each case, can be clamped to a stand to make operation easier.

Repeat the procedure for the second measurement after removing the film (“coating removal”) or applying the film (“coating application”).

Carry out each measurement such that:

- when using a micrometre as described in [5.2.4.1.1](#), the spindle is moved against the surface to be tested until the ratchet is activated;
- when using a dial gauge as described in [5.2.4.1.2](#), the surface is carefully contacted by the tip of the spring-loaded contact element.


The film thickness is the difference between the reading obtained for the total thickness and that obtained for the substrate thickness.

## 5.2.5 Method 4B — Depth gauging

### 5.2.5.1 Instruments and reference materials (reference specimens)

#### 5.2.5.1.1 Version 1 — Micrometer depth gauge (see [Figure 8](#))

Micrometres of this type are typically capable of measuring to the nearest 5 µm, or better. The micrometre shall be fitted with a ratchet to limit the force exerted by the contact element on the substrate. It has a flat base or foot which is placed on the coating surface and acts as a reference plane.

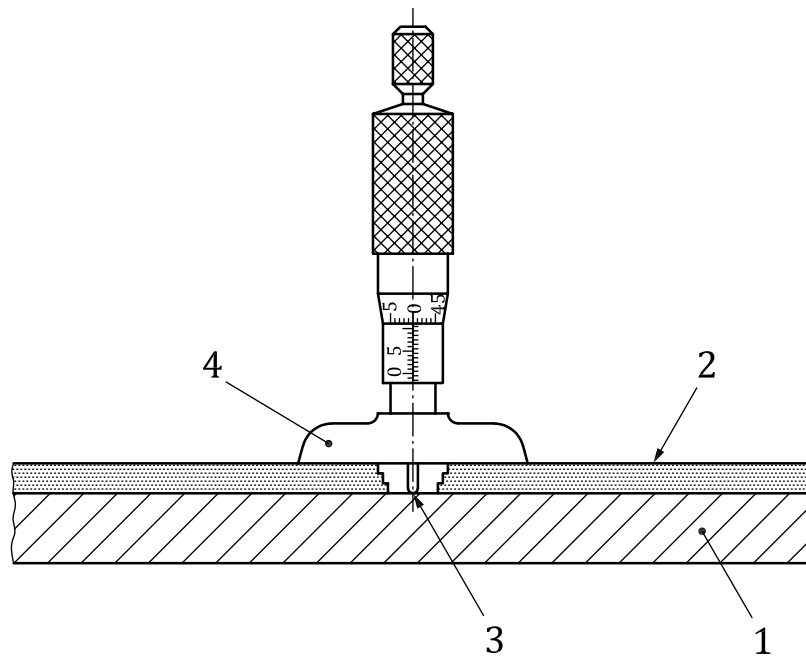
**Key**

- 1 substrate
- 2 coating
- 3 contact element
- 4 flat base or foot

**Figure 8 — Micrometer depth gauge**

#### 5.2.5.1.2 Version 2 — Dial depth gauge (see [Figure 9](#))

Analogue dial gauges conforming to the requirements of ISO 463 and digital dial gauges are typically capable of measuring to an accuracy of 5  $\mu\text{m}$  (analogue dial gauge) or 1  $\mu\text{m}$  (digital dial gauge), or better. Instead of a flat measuring bridge, two contact pins of equal length can be fixed to the bottom side of the dial gauge. Both need to be arranged in equal distance and aligned to the movable contact element as shown in [Figure 9](#). The gauge can have a flat base or foot which is placed on the coating surface and acts as a reference plane.

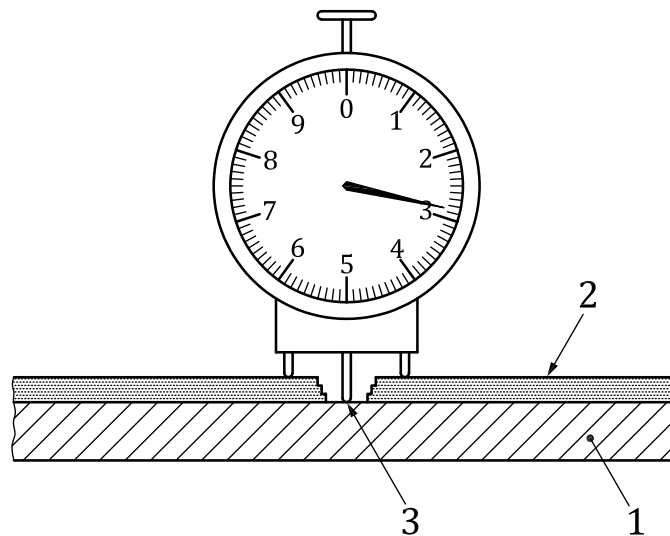**Key**

- 1 substrate
- 2 coating
- 3 contact element

**Figure 9 — Dial depth gauge****5.2.5.1.3 Reference materials for zeroing the gauge**

A flat reference plate is required for zeroing the gauge. The reference plate shall be a polished glass plate.

**5.2.5.2 Procedure**

Remove the coating from the measurement area. Zero the instrument by checking the zero point with the reference plate ([5.2.5.1.3](#)) and then:


- a) when using a micrometre depth gauge, place the foot on the coating surface so that the spindle is above the exposed area and screw the spindle down until the tip touches the substrate and the ratchet is actuated;
- b) when using a dial depth gauge, place the contact element on the exposed substrate and the foot (or contact pins) on the coating (if the gauge is of the type with contact pins, care shall be taken to ensure that they are perpendicular to the specimen surface).

The film thickness can be read off directly as a depth reading (correcting, as necessary, for any zero error).

**5.2.6 Method 4C — Surface profile scanning****5.2.6.1 Description of instrument**

This instrument comprises a traversing stylus connected to suitable amplifying and recording equipment. For the purposes of film-thickness measurements, the instrument is used to record the profile of a shoulder formed between the substrate and the coating by removal of part of the coating (see [Figure 10](#)). Roughness or profile gauges with a freely moving stylus in which the radius of the stylus tip is selected to match the roughness of the substrate and film surface are the most suitable.

**NOTE** Measurements can also be made optically or acoustically (i.e. without any contact with the specimen).

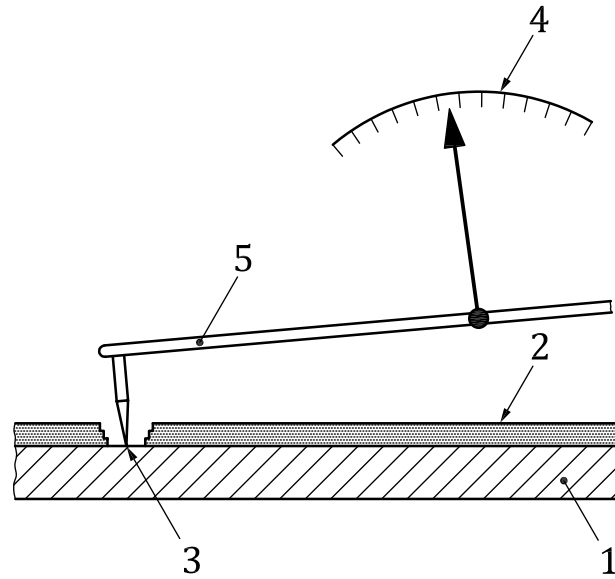

**Key**

- 1 substrate
- 2 coating
- 3 stylus tip
- 4 scale
- 5 lever

**Figure 10 — Surface profile scanner**

### 5.2.6.2 Procedure

Prepare the specimen as specified in 5.2.3. Scan and record the surface profile in the measurement area using an appropriate monitor and plotter.

The following factors can adversely affect the readings:

- inadequately cleaned surfaces;
- vibrations in the gauging system;
- the use of an unsuitable stylus tip.

Draw reference lines through the mean height of the trace recorded for the film surface (upper line) and through the trace recorded for the substrate (lower line). Measure the film thickness as the distance between the reference lines at the mid-point of the shoulder.

## 5.3 Gravimetric method

### 5.3.1 Principle

The dry-film thickness,  $t_d$ , in micrometres, is calculated from the difference between the mass of the uncoated specimen and that of the coated specimen using [Formula \(2\)](#):

$$t_d = \frac{m - m_0}{A \cdot \rho_o} \quad (2)$$



where

$m_0$  is the mass of the uncoated specimen, in grams;

$m$  is the mass of the coated specimen, in grams;

$A$  is the coated surface area, in square metres;

$\rho_0$  is the density of the dry coating material applied, in grams per cubic centimetre.

NOTE The dry-film density of the coating material can be determined in accordance with ISO 3233-1, ISO 3233-2 or ISO 3233-3.

### 5.3.2 Field of application

The gravimetric method has general applicability.

### 5.3.3 General

Using the gravimetric method yields the mean value of the dry-film thickness over the entire coated surface area. With spray application in particular, the reverse side of the specimen shall be masked to prevent measurement errors resulting from partial coating of the reverse (overspray).

### 5.3.4 Method 5 — By difference in mass

#### 5.3.4.1 Apparatus

Required are scales capable of weighing up to 500 g to the nearest 1 mg.


#### 5.3.4.2 Procedure

Weigh the clean uncoated specimen, coat it, dry it and reweigh. Calculate the dry-film thickness using [Formula \(2\)](#).

## 5.4 Optical methods

### 5.4.1 Principle

In the cross-sectioning method (method 6A, see [5.4.4](#)) the specimen is ground/cut along a plane normal to the coating so that the film thickness can be measured directly using a microscope (see [Figure 11](#)).

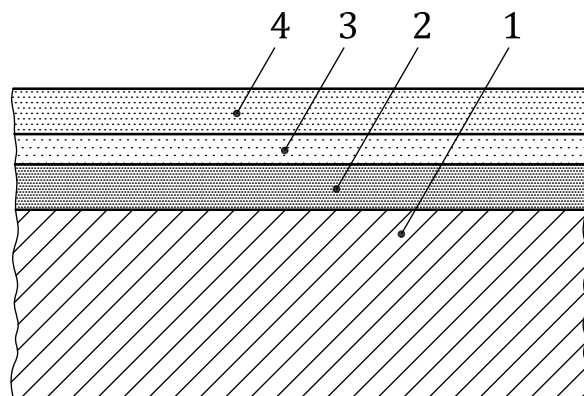**Key**

- 1 substrate
- 2 coating 1
- 3 coating 2
- 4 coating 3

**Figure 11 — Cross-sectioned specimen**


With the wedge cut method (method 6B, see [5.4.5](#)) a cut of defined dimensions is made in the coating using a cutting tool at a specified angle to the surface (see [Figure 12](#)). The film thickness,  $t$ , is calculated using [Formula \(3\)](#):

$$t = b \cdot \tan \alpha \quad (3)$$

where

$b$  is the projected half-width of the cut (from the edge to the substrate), determined using a microscope;

$\alpha$  is the angle of the cut.

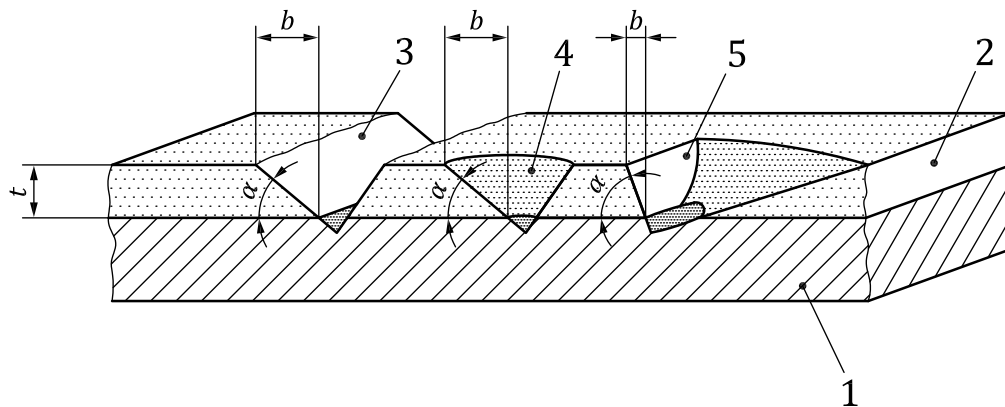


#### Key

- 1 substrate
- 2 coating
- 3 symmetrical cut
- 4 conical bore
- 5 sloping cut
- $b$  projected half-width of the cut (from the edge to the substrate), determined using a microscope
- $t$  film thickness
- $\alpha$  angle of cut

**Figure 12 — Symmetrical cut, conical bore and sloping cut**

The symmetrical wedge cut (key 3 in [Figure 12](#)) can be made in the coating using a special blade, the conical bore (key 4 in [Figure 12](#)) by a special borer and the sloping cut (key 5 in [Figure 12](#)) with a milling tool.

With white-light interferometry (method 6C, see [5.4.6](#)) the thickness is measured by means of interference with white light (see [Figure 13](#)). The measured interferences are compared with values which were previously determined on films with a known thickness through a secured method.

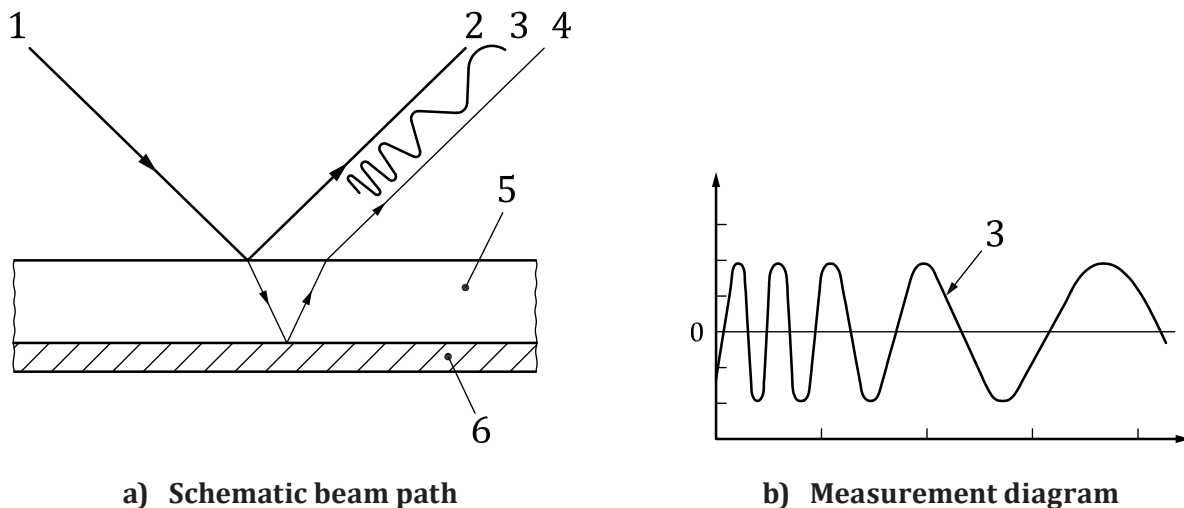

**Key**

- 1 ingressing light beam
- 2 reflected partial beam 1
- 3 interference
- 4 reflected partial beam 2
- 5 coating
- 6 substrate

**Figure 13 — White-light interferometry**

### 5.4.2 Field of application

The optical principle is basically suitable for all film-substrate combinations. The thicknesses of the individual layers in a multilayer coating can also be measured, provided the layers are sufficiently distinct in contrast from each other.

If the cross-sectioning or wedge cut method is used, the substrate will have to have the properties necessary for it to be sectioned, bored or cut.

In the event of a dispute, the cross-sectioning method (method 6A, see [5.4.4](#)) is recognized as the referee method.

Film thickness measurement with the white light interferometer (method 6C, see [5.4.6](#)) is applicable for optically transparent films.

### 5.4.3 General

If the coating material is elastic, the cross-section/wedge cut can be so deformed that measurement gives invalid results. This effect may be reduced by cooling the specimen before making the cut.

The measurement surface of the specimen shall be flat (in addition see the Note in [5.4.5.2](#)).

In the event of a brittle and/or inadequately bonded coating, delamination of the film can make it difficult to determine the true interface between the coating and the substrate.

With white-light interferometry the light interference can be influenced by the geometry of the substrate, e.g. curvature and roughness.

## 5.4.4 Method 6A — Cross-sectioning

### 5.4.4.1 Version 1 — By grinding

#### 5.4.4.1.1 Apparatus and materials

##### 5.4.4.1.1.1 Grinding and polishing machine

Apparatus which is used for producing metallographic preparations is suitable.

##### 5.4.4.1.1.2 Embedding medium

Use a cold-setting resin that has no deleterious effect on the coating and gives gap-free embedding.

##### 5.4.4.1.1.3 Grinding and polishing media

Use waterproof abrasive paper, for example P280, P400 and P600 grit, or suitable grades of diamond paste or a similar paste.

##### 5.4.4.1.1.4 Measuring microscope

A microscope with a suitable illumination system achieving optimum image contrast is required. The magnification shall be chosen such that the field of vision corresponds to 1,5 to 3 times the film thickness. The eyepiece or optoelectronic measurement device shall permit measurements to be made to an accuracy of at least 1 µm.

##### 5.4.4.1.2 Procedure

Embed the specimen or a representative sample of the specimen in the resin ([5.4.4.1.1.2](#)). Wet-polish the specimen or sample using the grinding and polishing machine ([5.4.4.1.1.1](#)) along a plane vertical to the coating surface. Repeat this process with an ever-finer grade of abrasive. Measure the thickness(es) of the exposed layer(s) using the microscope.

### 5.4.4.2 Version 2 — By cutting

#### 5.4.4.2.1 Apparatus

##### 5.4.4.2.1.1 Cutter

Required is a traversing or rotary microtome with carbide blades of suitable geometry and a holder for clamping the specimen in place.

##### 5.4.4.2.1.2 Measuring microscope

Required is a microscope with a suitable illumination system giving optimum image contrast. The magnification shall be chosen such that the field of vision corresponds to 1,5 to 3 times the film thickness. The eyepiece or optoelectronic measurement device shall permit measurements to be made to an accuracy of at least 1 µm.

##### 5.4.4.2.2 Procedure

Clamp the specimen or a representative sample taken from the specimen in the microtome specimen holder and cut along a plane perpendicular to the coating surface. Measure the thicknesses of the exposed layers using the microscope.

## 5.4.5 Method 6B — Wedge cut

### 5.4.5.1 Apparatus

#### 5.4.5.1.1 General

A cutter and a measuring microscope are required for the wedge cut method. These can both be incorporated in a single instrument.

#### 5.4.5.1.2 Cutter

Required is a special instrument with a replaceable cutting tool for producing precise cuts at the specified angle.

The cutting tool (cutting blade, special paint borer or milling tool) shall

- be made of a carbide material;
- have precisely ground cutter flanks;
- be of suitable geometry to ensure accurate wedge cuts.

Standard cutting angles are in the range  $\alpha = 5,7^\circ$  ( $\tan \alpha = 0,1$ ) to  $\alpha = 45^\circ$  ( $\tan \alpha = 1$ ).

#### 5.4.5.1.3 Measuring microscope or digital measurement equipment

A microscope with approximately  $\times 50$  magnification and an illumination device is required. The eyepiece shall permit measurements to be made to the nearest 20  $\mu\text{m}$ . Digital measurement equipment may be used as an alternative.

### 5.4.5.2 Procedure

Mark the specimen with, for example, a felt-tip pen in a contrasting colour in the measurement area. Make the cut or bore through this mark. The cut or bore shall penetrate into the substrate. Using the mark to locate the cut or bore with the microscope or the digital measurement equipment, measure the projected half-width,  $b$ , and calculate the film thickness(es) using [Formula \(3\)](#) (see [5.4.1](#)).

NOTE [Formula \(3\)](#) cannot be used with curved surfaces. A modified calculation formula can be used for conical bores in curved surfaces, however.

## 5.4.6 Method 6C — White-light interferometry

### 5.4.6.1 Instrument and reference material

#### 5.4.6.1.1 White-light interferometer

Commercial white-light interferometer.

#### 5.4.6.1.2 Reference material

A reference material with a known thickness is required for calibration purposes.

### 5.4.6.2 Procedure

Operate the instrument in accordance with the manufacturer's instructions. Read the thickness directly from the display.

## 5.5 Magnetic methods

### 5.5.1 Principle

The film thickness is determined from the interaction between a magnetic field and the metallic substrate. The film thickness is determined from the force required to remove a magnet from the coating (method 7A, see [5.5.4](#)), or from changes in the magnetic field (methods 7B.1, 7B.2 and 7C, see [5.5.5](#), [5.5.6](#) and [5.5.7](#)).

### 5.5.2 Field of application

Magnetic methods are suitable for coatings on metal substrates.

For methods 7A, 7B.1 and 7B.2, the substrate shall be ferromagnetic, and for method 7C non-ferromagnetic.

The properties of the coating shall be such that the reading is not rendered invalid when the measuring probe touches the coating surface.

### 5.5.3 General

The magnetic field produced by the instrument can be affected, among other things, by the following factors:

- the geometry of the substrate (dimensions, curvature and thickness);
- the properties of the substrate material (e.g. permeability, conductivity and properties resulting from any pretreatment);
- the roughness of the substrate;
- other magnetic fields (residual magnetism of the substrate and external magnetic fields).

See ISO 2178[3] and ISO 2360[4] for further influencing factors.

### 5.5.4 Method 7A — Magnetic pull-off gauge

#### 5.5.4.1 Description of instrument

This instrument contains a magnet for determining the film thickness from the force of attraction between the magnet and the substrate (see [Figure 14](#)).

NOTE The instrument shown in [Figure 14](#) a) can be used in any position. The instrument shown in [Figure 14](#) b) is designed for use only in one orientation because of the effect of gravity.

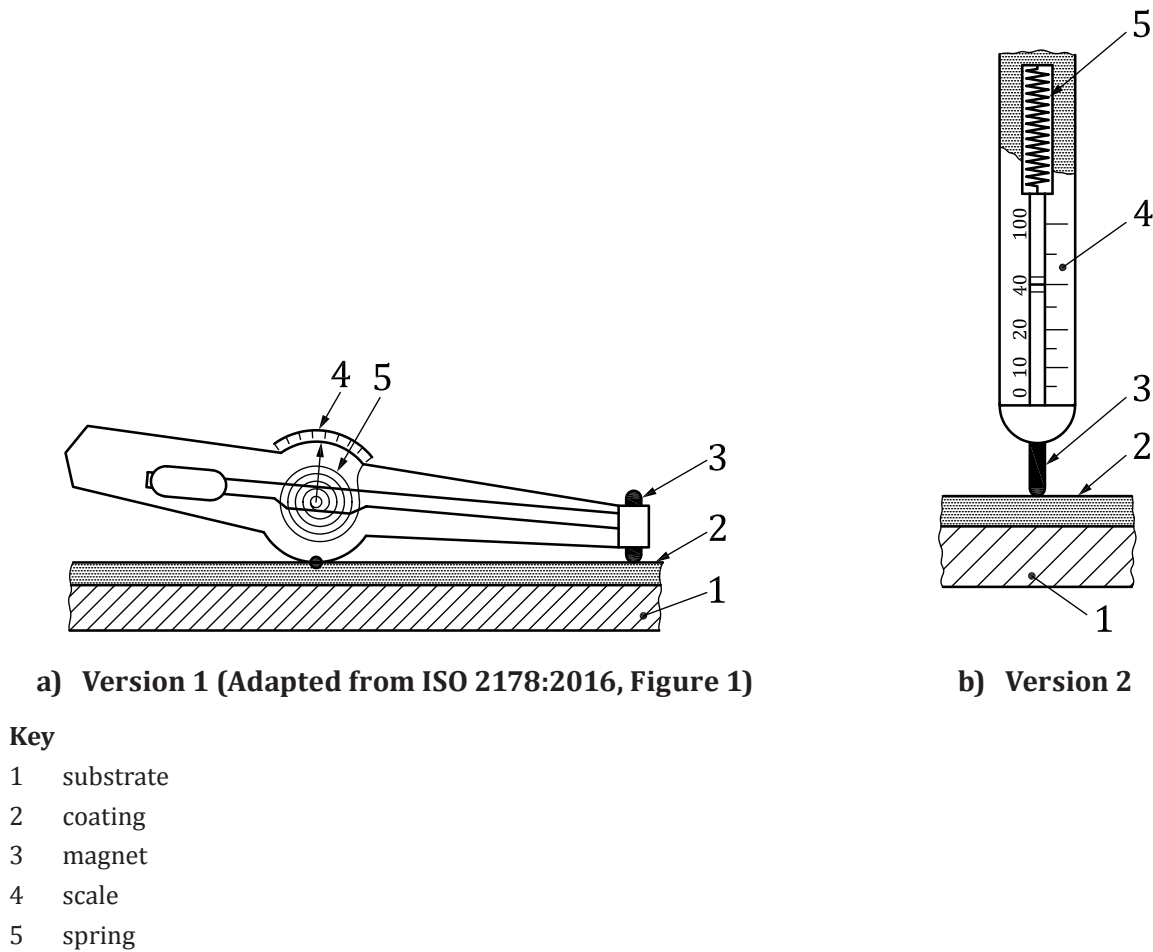


Figure 14 — Magnetic pull-off gauge

#### 5.5.4.2 Procedure


Place the instrument with the magnet against the coating. Lift the magnet away from the coating in a direction perpendicular to the coating surface. The film thickness is derived from the force required to remove the magnet from the specimen.

#### 5.5.5 Method 7B.1 — Magnetic-flux gauge

##### 5.5.5.1 Description of instrument

This instrument contains a magnet for determining the film thickness from the change, caused by the substrate, in the magnetic field of the magnet. The magnetic field is measured with a Hall probe (see [Figure 15](#)).

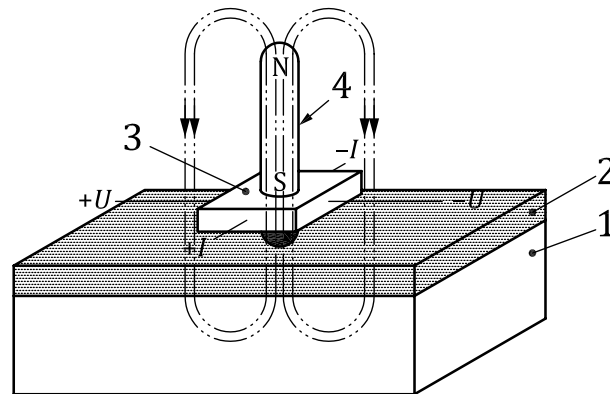

**Key**

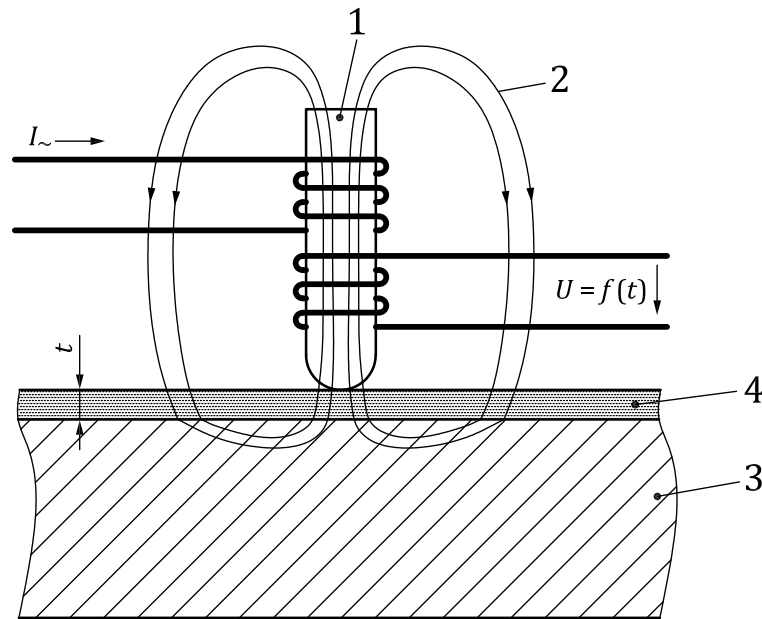
- 1 substrate
- 2 coating
- 3 hall element
- 4 magnet
- $U$  hall voltage
- $I$  control current

**Figure 15 — Hall probe****5.5.5.2 Procedure**

Place the instrument on the coating so that it is perpendicular to the coating. Read the thickness directly from the dial or calculate it in accordance with the manufacturer's instructions.

**5.5.6 Method 7B.2 — Magnetic field change, magnetic-induction principle****5.5.6.1 Description of instrument**

This instrument contains a coil system for determining the film thickness from the change produced in the magnetic field when it approaches a ferromagnetic substrate (see [Figure 16](#)). A low-frequency (<1 kHz) alternating electromagnetic field is generated by the coil system.

**Key**

1	ferromagnetic core of the probe	$I_{\sim}$	excitation current
2	low-frequency alternating magnetic field	$t$	thickness
3	steel/iron substrate	$U = f(t)$	measurement signal
4	coating		

**Figure 16 — Principle of magnetic-induction gauge (Adapted from ISO 2178:2016, Figure 2)**


### 5.5.6.2 Procedure

Place the instrument on the coating so that it is perpendicular to the coating. The film thickness is calculated from the change in the magnetic flux.

## 5.5.7 Method 7C — Eddy-current gauge

### 5.5.7.1 Description of instrument

This instrument contains an electromagnet for determining the film thickness from the change in the magnetic field caused by eddy currents in the electrically conductive substrate (see [Figure 17](#)). A high-frequency ( $>1$  kHz) alternating electromagnetic field is generated in the electromagnet.

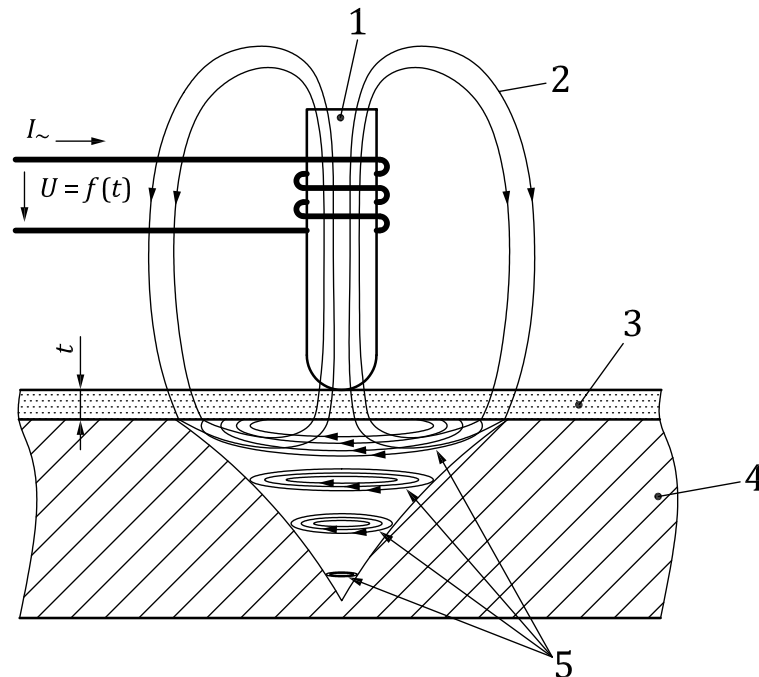**Key**

1	ferrite core of the probe	$I_{\sim}$	excitation current
2	high-frequency electromagnetic field	$U = f(t)$	measurement signal
3	coating	$t$	thickness
4	base metal		
5	induced eddy current		

**Figure 17 — Example for the eddy current method (Adapted from ISO 2360:2017, Figure 1)**

### 5.5.7.2 Procedure

Place the instrument on the coating so that it is perpendicular to the coating.

## 5.6 Radiological method

### 5.6.1 Principle

The film thickness is determined from the interaction between ionizing radiation and the coating. A radioisotope is used as the radiation source.

### 5.6.2 Field of application

The radiological principle is suitable for any film-substrate combination, provided the difference between the atomic number of the coating material and that of the substrate is at least 5 (see ISO 3543<sup>[12]</sup>).

### 5.6.3 General

Measurement of the film thickness can be affected by:

- the geometry of the substrate (dimensions, curvature);
- impurities at the surface of the coating;


- variations in the coating density.

## 5.6.4 Method 8 — Beta backscatter method

### 5.6.4.1 Description of instrument

The beta backscatter apparatus (see [Figure 18](#)) consists of:

- a radiation source (radioisotope) which emits mainly beta particles having an energy appropriate to the film thickness to be measured;
- a probe or measurement system with a range of apertures and containing a beta detector to count the number of backscattered beta particles (e.g. a Geiger counter);
- a data-processing and display system.

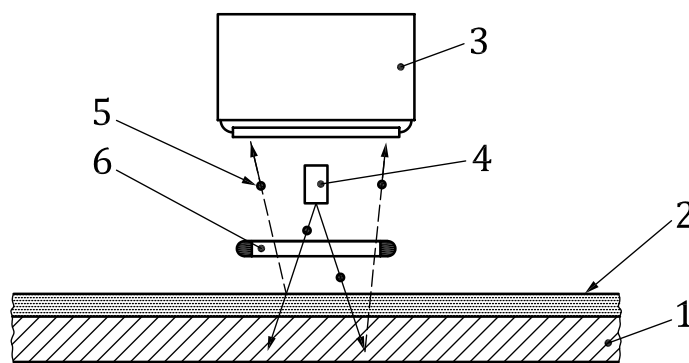

#### Key

- 1 substrate
- 2 coating
- 3 counter
- 4 radioisotope
- 5 backscattered particles
- 6 aperture

**Figure 18 — Beta backscatter method**

### 5.6.4.2 Verification

Verify and, if necessary, adjust the instrument with standards having as far as possible a coating and substrate of the same composition as the specimen to be examined.


### 5.6.4.3 Procedure

Operate the instrument in accordance with the manufacturer's instructions.

## 5.7 Photothermal method

### 5.7.1 Principle

The film thickness is determined from the difference between the time a thermal wave is radiated towards the coating and the time the re-emitted wave (either heat or ultrasonic) is detected (see [Figure 19](#)).

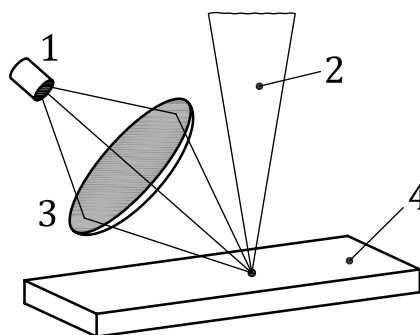**Key**

- 1 infrared detector
- 2 excitation beam
- 3 thermal radiation
- 4 specimen

**Figure 19 — Representation of radiometric detection**

Irrespective of the type of excitation involved or the method of detection, all photothermal methods use the same principle: the periodic or pulsed introduction of energy in the form of heat into a specimen and the subsequent detection of the local temperature increase.

The time difference measured is compared against values obtained with the instrument for films of known thickness under fixed conditions (excitation energy, pulse length, excitation frequency, etc.) (see [5.7.4.2](#)).

### 5.7.2 Field of application

The photothermal principle is basically suitable for all film-substrate combinations. It can also be used to determine the thicknesses of the individual layers in a multilayer coating, provided the layers are sufficiently distinct from each other with respect to their thermal conductivity and reflection properties.

The required minimum substrate thickness is a function of the measurement system used (see [5.7.4.1.1](#)) and the film-substrate combination.

### 5.7.3 General

Classification of the method as destructive or non-destructive depends on the purpose of the coating. The thermal energy absorbed by the coating could have an impact on the coating owing to the local heating effect produced.

### 5.7.4 Method 9 — Determination using thermal properties

#### 5.7.4.1 Instruments and reference materials (reference specimens)

##### 5.7.4.1.1 Measurement system

There are various methods for producing thermal waves in a coating material and for detecting the thermal effects induced at the heated location in the specimen (see EN 15042-2[28]). Thermal radiation sources (e.g. laser sources, light-emitting diodes, incandescent light sources) are mainly used as the excitation system for paint coatings.

The following detection methods are used:

- detection of the re-emitted thermal radiation (photothermal radiometry);

- detection of the change in refractive index (in the heated air above the measurement area);
- pyroelectric detection (heat flow measurement).

#### 5.7.4.1.2 Reference materials

Reference materials with different absorption properties and a range of film thicknesses are required for verification purposes (see EN 15042-2<sup>[28]</sup>).

#### 5.7.4.2 Verification

Verify and, if necessary, adjust the measurement system with the reference materials (see [5.7.4.1.2](#)) for each film-substrate combination (in particular for each coating material).

#### 5.7.4.3 Procedure

Operate the instrument in accordance with the manufacturer's instructions. Read the thickness directly from the display or calculate it in accordance with the manufacturer's instructions.

### 5.8 Acoustic method

#### 5.8.1 Principle

In the acoustic method the individual film thicknesses are determined from the propagation times of a partially reflected ultrasonic pulse at the interfaces of the coating system. See ISO/TS 19397.

#### 5.8.2 Field of application

The acoustic principle is suitable for any film-substrate combination.

The sound velocity shall be uniform in the individual layers and shall differ significantly from the sound velocity in the adjacent layer and in the substrate.

NOTE Inhomogeneities in the coating (e.g. the presence of aluminium flakes) and in the substrate (e.g. the grain in wood) can influence the result.


#### 5.8.3 General

The acoustic field can be affected by the geometry of the substrate (dimensions, curvature and roughness).

#### 5.8.4 Method 10 — Ultrasonic reflection

##### 5.8.4.1 Description of instrument

This instrument has an ultrasonic transmitter and a receiver for calculating the film thickness on the basis of the time interval elapsed between entry and exit of the ultrasonic waves (see [Figure 20](#)).

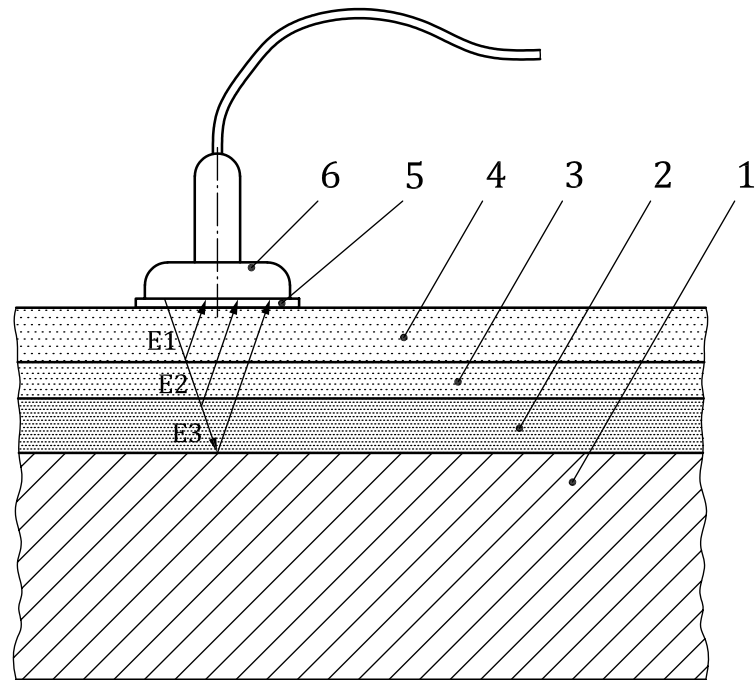

#### Key

- 1 substrate
- 2 coating 1
- 3 coating 2
- 4 coating 3
- 5 couplant
- 6 ultrasonic probe (transmitter and receiver)
- E echo 1, 2, 3

**Figure 20 — Ultrasonic method**

#### 5.8.4.2 Procedure


Apply a couplant to the coating whose thickness is to be measured. Place the instrument with the probe face flat on the coating. The coating thickness is calculated from the time interval required by the ultrasound to travel through the coatings and back.

### 5.9 Electromagnetic method


#### 5.9.1 Method 11 — Terahertz method

##### 5.9.1.1 Description of instrument

An instrument having a terahertz transmitter and a terahertz receiver for determining the film thickness through the sum of the reflections (see [Figure 21](#)).

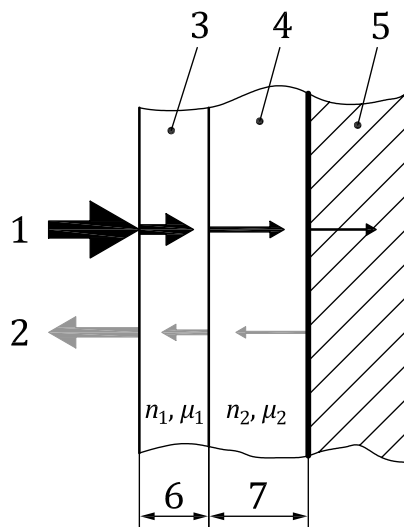

a) Schematic beam path

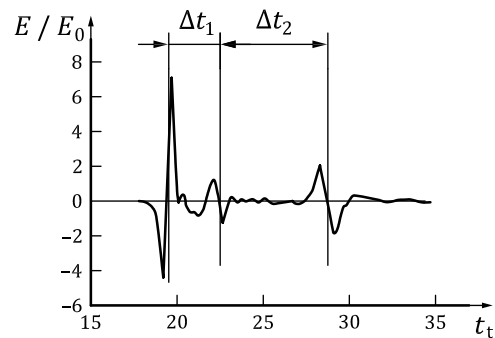

b) Measurement diagram

#### Key

1	ingressing terahertz radiation
2	sum of all reflected pulses
3	film 2
4	film 1
5	substrate
6	thickness of film 2
7	thickness of film 1
$n_1, \mu_1$	refractive index and/or extinction coefficient of film 2 for the terahertz range used
$n_2, \mu_2$	refractive index and/or extinction coefficient of film 1 for the terahertz range used
$E/E_0$	relative electrical field
$t_t$	time, in picoseconds (ps)
$\Delta t_1$	double pulse propagation of the first reflex in film 2
$\Delta t_2$	double pulse propagation of the second reflex in film 1

**Figure 21 — Principle of terahertz measurement**

Introduce periodic terahertz radiation into the specimen and then detect the reflected portions of the pulse. The sum of all reflected pulses is detected and the thickness of the individual films calculated from this pulse curve. The prerequisite for this calculation is knowledge of the material constants  $n$  and  $\mu$  of each film.

#### 5.9.1.2 Field of application

The terahertz measurement principle is suitable for nearly all film-substrate combinations. However, pure layers of metal, e.g. galvanic coatings cannot be measured using this method. It can be used in particular in order to determine the thickness of individual films in a multilayer system if the material constants  $n$  and  $\mu$  of the individual films sufficiently differ.

The detectable minimum thickness of a film is approximately 5  $\mu\text{m}$ . This minimum film thickness and the maximum determinable film thickness depend on the material properties of the coating and the substrate and the measurement system used.



### 5.9.1.3 General

The terahertz method is a non-destructive method.

## 6 Determination of thickness of uncured powder layers

### 6.1 General

[Annex A](#) gives an overview of the methods used for determination of the thickness of uncured powder layers.

### 6.2 Gravimetric method

#### 6.2.1 Principle

The film thickness of the uncured powder layer,  $t_p$ , in micrometres is calculated from the difference between the mass of the uncoated specimen and that of the coated specimen using [Formula \(4\)](#):

$$t_p = \frac{m - m_0}{A \cdot \rho_p} \quad (4)$$

where

$m_0$  is the mass of the uncoated specimen, in grams;

$m$  is the mass of the coated specimen, in grams;

$A$  is the coated surface area, in square metres;

$\rho_p$  is the density of the uncured powder coating material applied, in grams per millilitre.

NOTE The density of the powder coating material can be determined in accordance with ISO 8130-2 or ISO 8130-3.

#### 6.2.2 Field of application

The gravimetric method has general applicability.

#### 6.2.3 General

Using the gravimetric method yields the mean value of the film thickness over the entire coated surface area. When applying the powder, the reverse side of the specimen shall be masked to prevent measurement errors resulting from partial coating of the reverse side (overspray).

#### 6.2.4 Method 12 — By difference in mass

##### 6.2.4.1 Apparatus

Required are scales capable of weighing up to 500 g to the nearest 1 mg.

##### 6.2.4.2 Procedure

Weigh the clean uncoated specimen, coat it and reweigh. Calculate the film thickness using [Formula \(4\)](#).

The second weighing shall be carried out immediately after powder application.

## **6.3 Magnetic methods**

### **6.3.1 Principle**

The film thickness is determined from the interaction between a magnetic field and the metallic substrate. The film thickness is determined from the change in the magnetic field.

### **6.3.2 Field of application**

Magnetic methods are suitable for coated metal substrates.

For method 13A, the substrate shall be ferromagnetic, and for method 13B non-ferromagnetic.

### **6.3.3 General**

The magnetic field produced by the instrument can be affected by the following factors:


- the geometry of the substrate (dimensions, thickness);
- the properties of the substrate material (e.g. permeability, conductivity and properties resulting from any pretreatment);
- the roughness of the substrate;
- other magnetic fields (residual magnetism of the substrate and external magnetic fields).

Only measurements on flat surfaces are permissible.

### **6.3.4 Method 13A — Magnetic-induction method**

#### **6.3.4.1 Description of instrument**

This instrument contains a coil system for determining the film thickness from the change produced in the magnetic field when it approaches a ferromagnetic substrate (see [Figure 22](#)). A low-frequency (<1 kHz) alternating electromagnetic field is generated by the electromagnet.

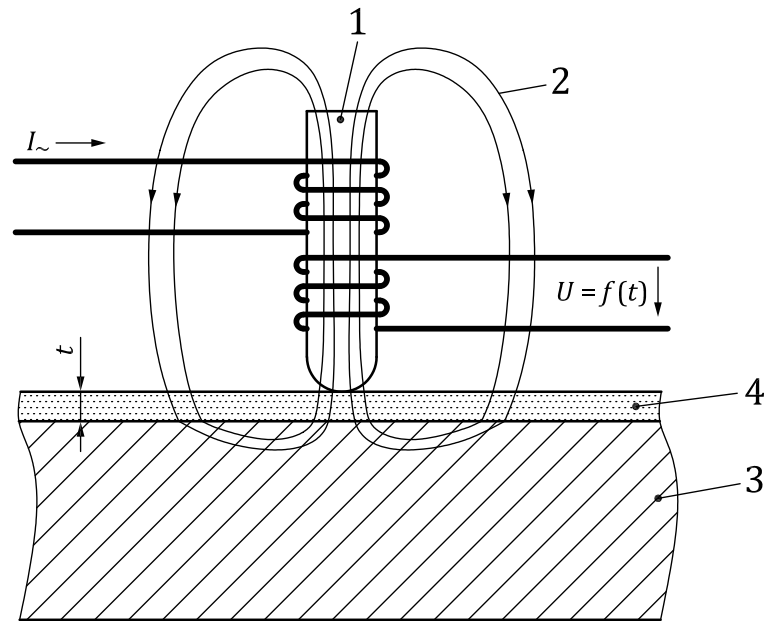**Key**

1	ferromagnetic core of the probe	$I_{\sim}$	excitation current
2	low-frequency alternating magnetic field	$t$	thickness
3	steel/iron substrate	$U = f(t)$	measurement signal
4	coating		

**Figure 22 — Measurement of a powder coating illustrated with the example of a magnetic induction probe**

The influence of the probe on the thickness of the uncured powder layer shall be kept to a minimum when positioning the probe.


#### 6.3.4.2 Procedure

Place the instrument on the coating so that it is perpendicular to the coating. The coating thickness is calculated from the change in the magnetic field or according to the manufacturer's instructions.

#### 6.3.5 Method 13B — Eddy-current

##### 6.3.5.1 Description of instrument

This instrument contains an electromagnet for determining the film thickness from the change in the magnetic field caused by eddy currents in the electrically conductive substrate (see [Figure 23](#)). A high-frequency (>1 kHz) alternating electromagnetic field is generated in the electromagnet.

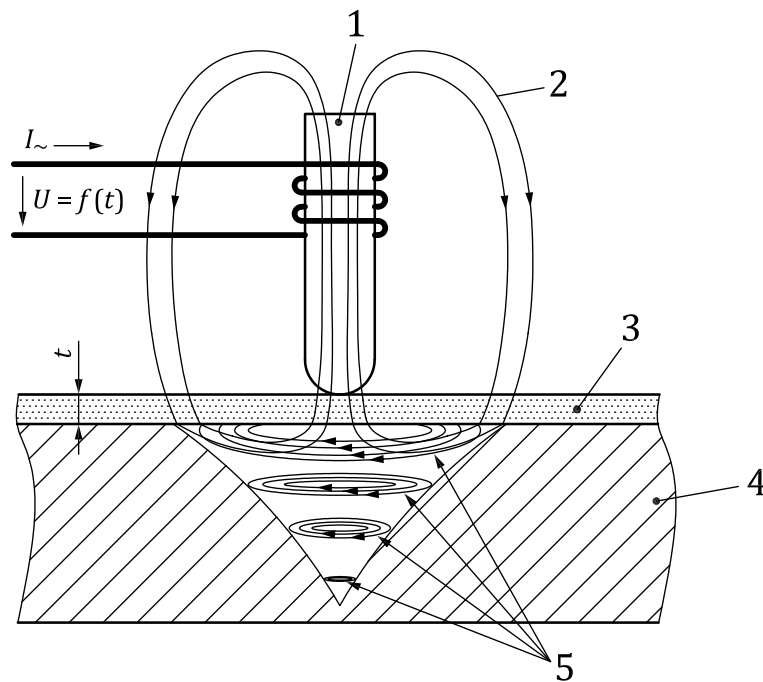**Key**

- |   |                                      |            |                    |
|---|--------------------------------------|------------|--------------------|
| 1 | ferrite core of the probe            | $I_{\sim}$ | excitation current |
| 2 | high-frequency electromagnetic field | $U = f(t)$ | measurement signal |
| 3 | coating                              | $t$        | thickness          |
| 4 | substrate                            |            |                    |
| 5 | induced eddy current                 |            |                    |

**Figure 23 — Eddy current method**

The influence of the probe on the film thickness of the uncured powder layer shall be kept to a minimum when positioning the probe.

**6.3.5.2 Procedure**

Place the instrument on the coating so that it is perpendicular to the coating. The coating thickness is determined by the change of the magnetic field.

**6.4 Photothermal method****6.4.1 Principle**

The film thickness is determined from the difference between the time a thermal wave is radiated towards the coating and the time the re-emitted wave is detected (see [Figure 18](#)).

Irrespective of the type of excitation involved or the method of detection, all photothermal methods use the same principle: the periodic or pulsed introduction of energy in the form of heat into a specimen and the subsequent detection of the local temperature increase.

The time difference measured is compared to values obtained with the instrument for films of known thickness under fixed conditions (excitation energy, pulse length, excitation frequency, etc.) (see [6.4.4.2](#)).

## 6.4.2 Field of application

The photothermal principle is basically suitable for all film-substrate combinations. It can also be used to determine the thicknesses of the individual layers in a multilayer coating, provided the layers are sufficiently distinct from each other with respect to their thermal conductivity and reflection properties.

The required minimum substrate thickness is a function of the measurement system used (see [6.4.4.1.1](#)) and the film-substrate combination.

## 6.4.3 General

Classification of the method as destructive or non-destructive depends on the purpose of the coating. The thermal energy absorbed by the coating could have an impact on the coating owing to the local heating effect produced.

## 6.4.4 Method 14 — Determination using thermal properties

### 6.4.4.1 Instruments and reference materials (reference specimens)

#### 6.4.4.1.1 Measurement system

There are various methods for producing thermal waves in a coating material and for detecting the thermal effects induced at the heated location in the specimen (see EN 15042-2[28]). Thermal radiation sources (e.g. laser sources, light-emitting diodes, incandescent light sources) are mainly used as the excitation system for coatings.

The following detection methods are used:

- detection of the re-emitted thermal radiation (photothermal radiometry);
- detection of the change in refractive index (in the heated air above the measurement area);
- pyroelectric detection (heat flow measurement).

#### 6.4.4.1.2 Reference materials

Reference materials with different absorption properties and a range of film thicknesses are required for verification purposes (see EN 15042-2[28]).

#### 6.4.4.2 Verification

Verify and, if necessary, adjust the measurement system using the reference materials (see [6.4.4.1.2](#)) for each film-substrate combination (particularly for each film material).

#### 6.4.4.3 Procedure

Operate the instrument in accordance with the manufacturer's instructions. Read the thickness directly from the display or calculate it in accordance with the manufacturer's instructions.

## 7 Test report

The test report shall include the following information:

- a) all information necessary for identification of the product tested (manufacturer, product designation, batch number, etc.);
- b) reference to this document, i.e. ISO 2808:2019;

- c) the method and instrument used;
- d) the results of the test, including the results of the individual measurements and their mean;
- e) any deviations from the procedure specified;
- f) any unusual features (anomalies) observed during the test;
- g) the date of the test.

The test report may also contain the following additional information, if necessary:

- h) details of the substrate (material, thickness, pretreatment);
- i) the method used to coat the substrate and whether it was a single-coat or a multi-coat system;
- j) the length of time and conditions used for drying/curing (including stoving) of the coating and, if necessary, details of any ageing carried out before making the thickness measurements;
- k) the relevant surface area, the test areas and the number of measurement areas per test area;
- l) the mean film thickness and its standard deviation, the local film thickness and its standard deviation, and the minimum and maximum local film thickness.

## Annex A (informative)

### Overview of methods

An overview of the methods described in this document is given in [Tables A.1](#) to [A.3](#). The field of application, existing standards and the precision are specified for the individual methods. Examples of existing standards for individual methods are given.

**Table A.1 — Overview: Determination of wet-film thickness**

Principle	Method	Substrate	Characterisation	Standard	Precision <sup>a</sup>
Mechanical ( <a href="#">4.2</a> )	1A Comb gauge ( <a href="#">4.2.4</a> )	Any	Destructive Measure immediately after coating as long as film is not dry	ASTM D4414	—
	1B Wheel gauge ( <a href="#">4.2.5</a> )	Any		ASTM D1212	—
	1C Dial gauge ( <a href="#">4.2.6</a> )	Any		ISO 463 ISO 13102	—
Gravimetric ( <a href="#">4.3</a> )	2 By difference in mass ( <a href="#">4.3.4</a> )	Any	Non-destructive Measure immediately after coating as long as film is not dry  Knowledge of the area, the substrate mass and the density of the coating material required	ISO 3892	—
Photothermal ( <a href="#">4.4</a> )	3 Heat propagation ( <a href="#">4.4.4</a> )	Dependent on the difference in thermal conductivity between the substrate and the coatings	Non-destructive Measure immediately after coating as long as film is not dry	EN 15042-2	—

<sup>a</sup> The information is based on the historical data of the instrument manufacturer and the user; deviations are possible.

**Table A.2 — Overview: Determination of dry-film thickness**

Principle	Method	Substrate	Characterisation	Standard	Precision <sup>a</sup>
Mechanical ( <a href="#">5.2</a> )	4A Difference in thickness (micrometre/dial gauge) ( <a href="#">5.2.4</a> )	Any	Destructive Differential determination between substrate and coating	ASTM D1005 DIN 50933	See ASTM D1005.
	4B Depth gauging (micrometre/dial gauge) ( <a href="#">5.2.5</a> )	Any		DIN 50933	—
	4C Surface profile scanning (profilometer) ( <a href="#">5.2.6</a> )	Any		ISO 4518	—

<sup>a</sup> The information is based on the historical data of the instrument manufacturer and the user; deviations are possible.

Table A.2 (continued)

Principle	Method	Substrate	Characterisation	Standard	Precision <sup>a</sup>
Gravimetric (5.3)	5 By difference in mass (5.3.4)	Any	Non-destructive Knowledge of the area, the substrate mass and the dry film density of the coating required	—	—
Optical (5.4)	6A Cross-sectioning (5.4.4)	Any	Destructive	ISO 1463	—
	6B Wedge cut (5.4.5)	Any	The substrate shall be capable of being scratched, bored or cut	ISO 19399	—
	6C White-light interferometry (5.4.6)	Any	Non-destructive Only for transparent, in part also for semi-transparent coatings	ISO 25178-604	—
Magnetic (5.5)	7A Pull-off force (5.5.4)	Ferromagnetic	Non-destructive Metallic substrate	ISO 2178	—
	7B.1 Change of magnetic field resulting from Hall sensor principle (5.5.5)	Ferromagnetic		ISO 2178	—
	7B.2 Change of magnetic field resulting from Magnetic induction principle (5.5.6)	Ferromagnetic		ISO 2178	See ISO 2178.
	7C Eddy current (5.5.7)	Non-ferromagnetic — metallic		ISO 2360	See ISO 2360.
Radiological (5.6)	8 Beta backscatter method (5.6.4)	Any	Non-destructive A radioactive source of radiation is used.	ISO 3543	—
Photothermal (5.7)	9 Heat propagation (5.7.4)	Dependent on the difference in thermal conductivity between the substrate and the coatings	Non-destructive	EN 15042-2	—
Acoustic (5.8)	10 Ultrasonic reflections (5.8.4)	Dependent on the difference between the reflected acoustic waves of the substrate and the coatings	Non-destructive	ISO/TS 19397	See ISO/TS 19397

<sup>a</sup> The information is based on the historical data of the instrument manufacturer and the user; deviations are possible.



Table A.2 (continued)

Principle	Method	Substrate	Characterisation	Standard	Precision <sup>a</sup>
Electromagnetic (5.9)	11 Terahertz (5.9.1)	Largely independent of the substrate; provided that the material constants $n$ and $\mu$ sufficiently differ from one another	Non-destructive	—	—
<sup>a</sup> The information is based on the historical data of the instrument manufacturer and the user; deviations are possible.					

Table A.3 — Overview: Determination of the thickness of uncured powder layers

Principle	Method	Substrate	Characterisation	Standard	Precision <sup>a</sup>
Gravimetric (6.2)	12 By difference in mass (6.2.4)	Any	Non-destructive Knowledge of the area, the substrate mass and the dry film density of the coating required	ISO 3892	—
Magnetic (6.3)	13A Magnetic induction principle (6.3.4)	Ferromagnetic	Non-destructive	ISO 2178	—
	13B Eddy current (6.3.5)	Non-ferromagnetic — metallic		ISO 2360	—
Photothermal (6.4)	14 Heat dispersion (6.4.4)	Any	Non-destructive	EN 15042-2	—
<sup>a</sup> The information is based on the historical data of the instrument manufacturer and the user; deviations are possible.					

## Annex B (informative)

### Measurement of film thickness on rough surfaces

#### B.1 General

The surface roughness of a substrate influences the result of a film thickness determination. Therefore, special considerations apply for blast-cleaned steel substrates. If a coating is applied to a blast-cleaned steel substrate, the measurement of its thickness is more complicated than for smooth surfaces. The results are influenced by the properties of the substrate, which vary from point to point, and by the design of the measurement equipment. The procedure used to set up instruments on blast-cleaned substrates has in practice led to significant variability in the dry-film thickness readings.

In addition to the variation of results with the type of instrument used, zeroing an instrument on a blast-cleaned surface also introduces problems, such as:

- poor repeatability;
- variability in the measured thickness of a shim placed on such a surface (the thicker the shim the greater the apparent increase in shim thickness);
- the uncertainty involved when the surface roughness of the steel substrate is not known.

The purpose of the method described in this clause is to minimize variability and achieve uniformity of practice in the measurement of the thickness of coatings on blast-cleaned steel surfaces. The method entails the measurement of film thickness using an instrument of the magnetic-induction type previously zeroed on a smooth steel surface.

This method measures the coating thickness from an imaginary plane located between the peaks and the troughs of the rough surface of the substrate, typically about 25 µm below the peaks (i.e. about half of the surface roughness, expressed as the height from the bottom to the top of the peaks, of the blast-cleaned surface) except for surfaces prepared to a surface profile grading of “fine” as defined in ISO 8503-1.

The method describes the determination of a parameter representative of the thickness of a dried coating on a blast-cleaned steel substrate. The actual film thickness, as measured by a reference method, shall not be less than 25 µm and should preferably be greater than 50 µm in order to provide reliable results.

Other methods for determining the thicknesses of coatings on rough surfaces are described in ISO 19840<sup>[21]</sup>.

#### B.2 Apparatus and materials

**B.2.1 Film thickness measuring instrument**, of the magnetic-induction type, as used in method 7C (see 5.5.7).

Equipment fitted with facilities for calculating the mean standard deviation of measurements and other statistical parameters should be used with caution and preferably only by those trained in statistical techniques.

**B.2.2 Verification shims**, of the foil type, with assigned values traceable to nationally recognized standards, of thickness near to the expected film thickness.

The use of uncertified shims is permitted provided they are verified on site.

**B.2.3 Smooth steel plate**, free of mill scale and rust, similar in magnetic nature to the coated steel and at least 1,2 mm thick, for use in verifying the instrument.

## **B.3 Procedure**

### **B.3.1 Verification**

Before use, verify and, if necessary, adjust the instrument in accordance with the manufacturer's instructions for steel, using the smooth steel plate, which shall be polished with 400 grit abrasive paper to remove all staining and corrosion products before use. The verification shims shall be placed between the probe and the smooth steel plate. Verification shims of thicknesses above and below the expected film thickness shall be used.

### **B.3.2 Measurement**

Measurements on the dry coating shall be made in accordance with the instrument manufacturer's instructions for smooth steel. For the number of readings, see [B.3.3](#).

### **B.3.3 Number of readings**

It is advisable to take at least three readings evenly spread in each test area.

As a guide, it is recommended that there be two test areas every square metre for flat plates, four every metre length for webs, two every metre length for flanges and two or more every metre length for pipes (depending on pipe diameter).

It is generally recommended to take more readings for off-shore and other marine work.

## Annex C (informative)

### Factors affecting the precision of readings obtained when measuring on wooden substrates

#### C.1 General

Wood as a substrate for coatings has to be considered as rough compared to other materials such as metals or plastics. Hence, measurements of dry film thickness of coatings on wood usually lead to larger variance of results. Wood as a naturally grown material has got relatively complicated anatomical structures on a machined surface that need better consideration and guidance in the test procedure. A round robin on measurement of dry film thickness of coatings on wood revealed the need for a better definition of a reference line or interface between wood and coating as a basis for measurements.

This annex describes factors which influence the measurements of dry film thickness of coatings on wood including random sampling and definitions of measurement positions when the coating material penetrated the wood or wood fibers stick out of the surface.

#### C.2 Random sampling

At least 10 measurement positions have to be spread evenly over the width of the sample to be measured (panel or chip samples). In case of sampling of wood chips for measurement of coating film thickness, it is recommended to remove three chips at three different places spaced evenly across the panel width. Chips should not be taken close to edges or panel ends. Make five measurements on each of the three chips and calculate and record the mean value and standard deviation in micrometres. See [Figure C.1](#). [Figure C.1](#) shows panels for natural exposure according to EN 927-3 and ISO 16053. The panels have sealed ends.



Chips should be spaced evenly across the panel width (a) but should not be taken close to edges or panel ends (b).

**Figure C.1 — Spacing of chips on the panel**

Measurement positions have to be set randomly without preference on earlywood or latewood. Measurements should be taken with equidistant spacing to ensure randomisation. If measurement on a particular point is complicated, choose the next position planned.

#### C.3 Penetrating coating material

On hardwoods with coarse pores measurements shall be taken beside open vessels on the wood surface. Positions where the coating material penetrated open vessels shall not be included in the

measurements. No matter where the measurement is scheduled, coating material that has penetrated into open vessels shall not be included. See [Figure C.2](#).



Measurements shall be taken beside open vessels (a), coating material that has penetrated into open vessels shall not be included (b).

**Figure C.2 — Measurements on porous substrates**

On coniferous wood species (softwoods), measurements shall be taken from the uppermost wood surface, i.e. from the edges of wood cell walls on the surface that were cut in the machining process. No matter where the measurement is scheduled, coating material that has penetrated into tracheids shall not be included. See [Figure C.3](#).



Measurements shall be taken from the edges of wood cell walls on the surface that were cut in the machining process (a), coating material that has penetrated into open vessels shall not be included (b).

**Figure C.3 — Measurements on softwoods**

Single wood fibers sticking out of the surface into the coating film shall not be considered as measurement positions.

NOTE Single wood fibers sticking out of the surface can be weak points of the coating film for instance in weathering exposure.

## C.4 Orientation of measurements

Measurements shall be oriented perpendicular to the test surface.

## Bibliography

- [1] ISO 463, *Geometrical Product Specifications (GPS) — Dimensional measuring equipment — Design and metrological characteristics of mechanical dial gauges*
- [2] ISO 1463, *Metallic and oxide coatings — Measurement of coating thickness — Microscopical method*
- [3] ISO 2178, *Non-magnetic coatings on magnetic substrates — Measurement of coating thickness — Magnetic method*
- [4] ISO 2360, *Non-conductive coatings on non-magnetic electrically conductive base metals — Measurement of coating thickness — Amplitude-sensitive eddy-current method*
- [5] ISO 2811-1, *Paints and varnishes — Determination of density — Part 1: Pycnometer method*
- [6] ISO 2811-2, *Paints and varnishes — Determination of density — Part 2: Immersed body (plummet) method*
- [7] ISO 2811-3, *Paints and varnishes — Determination of density — Part 3: Oscillation method*
- [8] ISO 2811-4, *Paints and varnishes — Determination of density — Part 4: Pressure cup method*
- [9] ISO 3233-1, *Paints and varnishes — Determination of the percentage volume of non-volatile matter — Part 1: Method using a coated test panel to determine non-volatile matter and to determine dry film density by the Archimedes principle*
- [10] ISO 3233-2, *Paints and varnishes — Determination of the percentage volume of non-volatile matter — Part 2: Method using the determination of non-volatile-matter content in accordance with ISO 3251 and determination of the dry film density on coated test panels by the Archimedes principle*
- [11] ISO 3233-3, *Paints and varnishes — Determination of the percentage volume of non-volatile matter — Part 3: Determination by calculation from the non-volatile-matter content determined in accordance with ISO 3251, the density of the coating material and the density of the solvent in the coating material*
- [12] ISO 3543, *Metallic and non-metallic coatings — Measurement of thickness — Beta backscatter method*
- [13] ISO 3892, *Conversion coatings on metallic materials — Determination of coating mass per unit area — Gravimetric methods*
- [14] ISO 4518, *Metallic coatings — Measurement of coating thickness — Profilometric method*
- [15] ISO 8130-2, *Coating powders — Part 2: Determination of density by gas comparison pycnometer (referee method)*
- [16] ISO 8130-3, *Coating powders — Part 3: Determination of density by liquid displacement pycnometer*
- [17] ISO 13102, *Geometrical product specifications (GPS) — Dimensional measuring equipment: Electronic digital-indicator gauge — Design and metrological characteristics*
- [18] ISO 15189:2007<sup>1)</sup>, *Medical laboratories — Requirements for quality and competence*
- [19] ISO 16053, *Paints and varnishes — Coating materials and coating systems for exterior wood — Natural weathering test*
- [20] ISO/TS 19397, *Determination of the film thickness of coatings using an ultrasonic gage*

---

1) Now withdrawn. Replaced by ISO 15189:2012.

- [21] ISO 19399, *Paints and varnishes — Wedge-cut method for determination of film thickness (scribe and drill method)*
- [22] ISO 19840, *Paints and varnishes — Corrosion protection of steel structures by protective paint systems — Measurement of, and acceptance criteria for, the thickness of dry films on rough surfaces*
- [23] ISO 25178-604, *Geometrical product specifications (GPS) — Surface texture: Areal — Part 604: Nominal characteristics of non-contact (coherence scanning interferometry) instruments*
- [24] ISO/IEC Guide 99:2007, *International vocabulary of metrology — Basic and general concepts and associated terms (VIM)*
- [25] ASTM D1005, *Standard Test Method for Measurement of Dry Film Thickness of Organic Coatings Using Micrometers*
- [26] ASTM D1212, *Standard Test Methods for Measurement of Wet Film Thickness of Organic Coatings*
- [27] ASTM D4414, *Standard Practice for Measurement of Wet-film thickness by Notch Gages*
- [28] EN 927-3, *Paints and varnishes — Coating materials and coating systems for exterior wood — Part 3: Natural weathering test*
- [29] EN 15042-2, *Thickness measurement of coatings and characterization of surfaces with surface waves — Part 2: Guide to the thickness measurement of coatings by photothermic method*
- [30] DIN 50933, *Measurement of coating thicknesses — Measurement of the thickness of coatings by difference measurement using a stylus instrument*

